



2 Liberty Sq., 6th Floor
Boston, MA 02109

T 617.350.3444
TRCcompanies.com

Asbestos Abatement Air Sampling Report

L Street Station Project

Boston, Massachusetts

Prepared for HRP 776 Summer Street, LLC
August 2023

ASBESTOS ABATEMENT AIR SAMPLING REPORT

L STREET STATION PROJECT

August 2023

1.0 INTRODUCTION

TRC Environmental, Inc. (TRC) has prepared this Air Sampling Report on behalf of HRP 776 Summer Street, LLC (the Client) for the deconstruction phase of the L Street Station project at 776 Summer Street in Boston, Massachusetts (the Site).

The air sampling is as described and in accordance with the requirements of the Non-Traditional Work Plan (NTWP) in place for the project, as approved by MassDEP (NTWP Approval NNT-220007). Pursuant to the NTWP, on a daily basis, TRC provides air sampling during asbestos abatement around the perimeter of the asbestos removal work areas, and as required for final air clearance at the completion of asbestos removal in contained work areas. Sample results are emailed to MassDEP at the end of the shift.

The air samples are analyzed by TRC's Asbestos Project Monitor after collection, typically twice per shift, in accordance with the Phase Contrast Microscopy (PCM) method. The results for each sample are then recorded in fibers per cubic centimeter of air (f/cc) on the air sampling data sheet. These air sample results and data sheets are attached to this report.



This report provides the air sampling results collected at the Site from the beginning of the abatement monitoring on August 15, through 31, 2023. Pursuant to the NTWP approved by DEP, the air sampling action level is < 0.010 f/cc. All air sample collected at the containment perimeter barriers, by TRC in connection with this work have been less than 0.010 f/cc throughout this time period.

2.0 DESCRIPTION OF SITE CONDITIONS

The Site previously operated as an electrical power plant. With the exception of one building, referred to as the Administration Office Building, the Site is vacant.

The Site is located in an urban area of South Boston and is bounded on all sides by roads.

3.0 AIR SAMPLING ACTION LEVELS

The action level required for this project for PCM air samples during abatement, as established in the NTWP, is less than 0.010 f/cc. If this level is reached or exceeded, asbestos abatement work is stopped, the MassDEP notified, and appropriate corrective measures taken. The level of 0.010 f/cc is also used for air clearance following abatement, to "clear" space for use prior to disassembling containment. On occasion, typically for "clearing" a large work area where PCM air sampling may be impractical, the Transmission Electron Microscopy (TEM) method will be used, which has a clearance level of an average of less than 70 structures per square millimeter (s/mm). TEM results, if any, associated with clearing work areas will be included in this report.

4.0 AIR SAMPLING

Pursuant to the approved NTWP, all area air samples are collected using the same basic techniques. The air sampling pumps are calibrated using a primary or secondary standard. The sample cassette is set between 4 to 5 feet above the floor/ground and angled downward at a 45-degree angle. Samples are collected "open faced," meaning that the cap at the inlet end of the extension has been removed so the entire surface of the



filter is exposed to the air. Samples are typically collected over a 2-to-3-hour period. Pumps are post-calibrated and the before and after flow rates are averaged. Chain-Of-Custody forms are completed, and the samples are analyzed.

Air samples are usually grouped together for each work area, as per the NTWP. Some results are recorded as <LOD, meaning that the result for that sample is below the limit of detection for the method (typically less than 0.002 f/cc, which is well below the action level).

5.0 CORRECTIVE MEASURES

No corrective measures were required August 1-, through August 31, 2023, because all air sample results were below the action level.


ATTACHMENTS

Air sample results

Project Name	776 Summer Street (Building 3 Panel Caulking)	Sample Date	08/01/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 3	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	Southwest corner of building 3 on summer street sidewalk	07:33	10:41	188	8	8	8	1504	7.5	100	0.002	0.002	N/A
Area	004	Decon at center area Summer Street sidewalk	07:34	10:42	188	8	8	8	1504	5.5	100	0.002	0.002	N/A
Area	005	Northwest area corner of building 3 summer Street sidewalk	07:35	10:43	188	8	8	8	1504	6.5	100	0.002	0.002	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information


Analyst	David Adams	Analysis Date	08/01/2023
Analyst Signature			

Project Name		776 Summer Street (Background Sampling)					Sample Date		08/01/2023					
TRC Project #		474824					Sampling Technician		David Adams					
Client		HRP 776 Summer Street PropCo LLC					Laboratory		TRC					
Facility Name		776 Summer Multiple Areas					Sample/Analysis Method		NIOSH 7400					
Facility Location		776 Summer Street, Boston, Massachusetts					Sampling Type		PCM					
Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	B4 - South area at brick wall	07:31	10:39	188	8	8	8	1504	4.5	100	0.002	<LOD	N/A
Background	004	B4 - Center area at truck wash	07:32	10:40	188	8	8	8	1504	4	100	0.002	<LOD	N/A
Background	005	East 1st St. - Turbine hall 3 roof at base of scaffolding	07:41	10:49	188	8	8	8	1504	7	100	0.002	0.002	N/A
Background	006	East 1st St - gate E at water shed	07:46	10:54	188	8	8	8	1504	4	100	0.002	<LOD	N/A
Background	007	East 1st St. - West of Suffolk at dust monitor	07:47	10:55	188	8	8	8	1504	8	100	0.002	0.003	N/A
Background	008	B4 - South area at brick wall	10:39	13:40	181	8	8	8	1448	4	100	0.002	<LOD	N/A
Background	009	B4 - Center area at truck wash	10:40	13:41	181	8	8	8	1448	3.5	100	0.002	<LOD	N/A
Background	010	B4 - North area at building 3 corner	10:41	13:42	181	8	8	8	1448	5	100	0.002	0.002	N/A
Background	011	B3 - west area at summer Street sidewalk	10:45	13:44	179	8	8	8	1432	6.5	100	0.002	0.002	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	012	B3 - North area at portable generator	10:46	13:46	180	8	8	8	1440	7.5	100	0.002	0.003	N/A
Background	013	East 1st St. - Turbine hall 3 roof at base of scaffolding	10:49	13:51	182	8	8	8	1456	4	100	0.002	<LOD	N/A
Background	014	East 1st St - gate E at water shed	10:54	13:56	182	8	8	8	1456	4.5	100	0.002	0.002	N/A
Background	015	East 1st St. - West of Suffolk at dust monitor	10:55	13:57	182	8	8	8	1456	5.5	100	0.002	0.002	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information


Analyst	David Adams	Analysis Date	08/01/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS

Project Name		776 Summer Street (Background Sampling)					Sample Date		08/02/2023					
TRC Project #		474824					Sampling Technician		Diana Carolina Saune Barrientos					
Client		HRP 776 Summer Street PropCo LLC					Laboratory		TRC					
Facility Name		776 Summer Multiple Areas					Sample/Analysis Method		NIOSH 7400					
Facility Location		776 Summer Street, Boston, Massachusetts					Sampling Type		PCM					
Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	B4 - South area at brick wall	07:26	10:36	190	8	8	8	1520	9	100	0.002	0.003	N/A
Background	004	B4 - Center area at truck wash	07:27	10:37	190	8	8	8	1520	4	100	0.002	<LOD	N/A
Background	005	B4 - North area at building 3 corner	07:28	10:38	190	8	8	8	1520	6	100	0.002	0.002	N/A
Background	006	B3 - west area at summer Street sidewalk	07:29	10:39	190	8	8	8	1520	8.5	100	0.002	0.003	N/A
Background	007	B3 - North area at portable generator	07:31	10:41	190	8	8	8	1520	6	100	0.002	0.002	N/A
Background	008	East 1st St. - Turbine hall 3 roof at base of scaffolding	07:36	10:46	190	8	8	8	1520	8.5	100	0.002	0.003	N/A
Background	009	East 1st St - gate E at water shed	07:41	10:51	190	8	8	8	1520	6	100	0.002	0.002	N/A
Background	010	East 1st St. - West of Suffolk at dust monitor	07:42	10:52	190	8	8	8	1520	4.5	100	0.002	<LOD	N/A
Background	011	B4 - South area at brick wall	10:36	13:50	194	8	8	8	1552	3.5	100	0.002	<LOD	N/A

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	012	B4 - Center area at truck wash	10:37	13:51	194	8	8	8	1552	4	100	0.002	<LOD	N/A
Background	013	B4 - North area at building 3 corner	10:38	13:52	194	8	8	8	1552	4.5	100	0.002	<LOD	N/A
Background	014	B3 - west area at summer Street sidewalk	10:39	13:53	194	8	8	8	1552	6	100	0.002	0.002	N/A
Background	015	B3 - North area at portable generator	10:41	13:55	194	8	8	8	1552	5	100	0.002	0.002	N/A
Background	016	East 1st St. - Turbine hall 3 roof at base of scaffolding	10:46	14:00	194	8	8	8	1552	3.5	100	0.002	<LOD	N/A
Background	017	East 1st St - gate E at water shed	10:51	14:05	194	8	8	8	1552	1.5	100	0.002	<LOD	N/A
Background	018	East 1st St. - West of Suffolk at dust monitor	10:52	14:06	194	8	8	8	1552	3	100	0.002	<LOD	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	Diana Carolina Saune Barrientos		Analysis Date	08/02/2023
Analyst Signature				


ASBESTOS AIR SAMPLE RESULTS

Project Name	776 Summer Street (Background Sampling)	Sample Date	08/03/2023
TRC Project #	474824	Sampling Technician	Diana Carolina Saune Barrientos
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	776 Summer Multiple Areas	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	B4 - South area at brick wall	07:33	10:43	190	8	8	8	1520	5.5	100	0.002	0.002	N/A
Background	004	B4 - Center area at truck wash	07:34	10:44	190	8	8	8	1520	4.5	100	0.002	<LOD	N/A
Background	005	B4 - North area at building 3 corner	07:35	10:45	190	8	8	8	1520	7	100	0.002	0.002	N/A
Background	006	B3 - west area at summer Street sidewalk	07:36	10:46	190	8	8	8	1520	4	100	0.002	<LOD	N/A
Background	007	B3 - North area at portable generator	07:38	10:48	190	8	8	8	1520	6	100	0.002	0.002	N/A
Background	008	East 1st St. - Turbine hall 3 roof at base of scaffolding	07:44	10:53	189	8	8	8	1512	3	100	0.002	<LOD	N/A
Background	009	East 1st St - gate E at water shed	07:49	10:57	188	8	8	8	1504	5.5	100	0.002	0.002	N/A
Background	010	East 1st St. - West of Suffolk at dust monitor	07:50	10:58	188	8	8	8	1504	5	100	0.002	0.002	N/A
Background	011	B4 - South area at brick wall	10:43	13:57	194	8	8	8	1552	4	100	0.002	<LOD	N/A

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	012	B4 - Center area at truck wash	10:44	13:58	194	8	8	8	1552	3.5	100	0.002	<LOD	N/A
Background	013	B4 - North area at building 3 corner	10:45	13:59	194	8	8	8	1552	5	100	0.002	0.002	N/A
Background	014	B3 - west area at summer Street sidewalk	10:46	14:00	194	8	8	8	1552	3	100	0.002	<LOD	N/A
Background	015	B3 - North area at portable generator	10:48	14:02	194	8	8	8	1552	5.5	100	0.002	0.002	N/A
Background	016	East 1st St. - Turbine hall 3 roof at base of scaffolding	10:53	14:07	194	8	8	8	1552	3	100	0.002	<LOD	N/A
Background	017	East 1st St - gate E at water shed	10:57	14:12	195	8	8	8	1560	4.5	100	0.002	<LOD	N/A
Background	018	East 1st St. - West of Suffolk at dust monitor	10:58	14:13	195	8	8	8	1560	4	100	0.002	<LOD	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	Diana Carolina Saune Barrientos		Analysis Date	08/03/2023
Analyst Signature				


Project Name	776 Summer Street (Background Sampling)	Sample Date	08/04/2023
TRC Project #	474824	Sampling Technician	Diana Carolina Saune Barrientos
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	776 Summer Multiple Areas	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	East 1st St. - Turbine hall 3 roof at base of scaffolding	07:40	10:42	182	8	8	8	1456	4	100	0.002	<LOD	N/A
Background	004	East 1st St - gate E at water shed	07:45	10:47	182	8	8	8	1456	6	100	0.002	0.002	N/A
Background	005	East 1st St. - West of Suffolk at dust monitor	07:46	10:48	182	8	8	8	1456	4.5	100	0.002	0.002	N/A
Background	006	East 1st St. - Turbine hall 3 roof at base of scaffolding	10:42	13:46	184	8	8	8	1472	4	100	0.002	<LOD	N/A
Background	007	East 1st St - gate E at water shed	10:47	13:51	184	8	8	8	1472	5.5	100	0.002	0.002	N/A
Background	008	East 1st St. - West of Suffolk at dust monitor	10:48	13:52	184	8	8	8	1472	5	100	0.002	0.002	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	Diana Carolina Saune Barrientos	Analysis Date	08/04/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (Emergency Waiver)(Cornice - Building 4)	Sample Date	08/04/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	B4 south area	07:43	10:50	187	8	8	8	1496	3	100	0.002	<LOD	N/A
Area	004	B4 - Center area adjacent regulated area	07:44	10:50	186	8	8	8	1488	3.5	100	0.002	<LOD	N/A
Area	005	Truck wash	07:45	10:51	186	8	8	8	1488	5.5	100	0.002	0.002	N/A
Area	006	North area at gate D	07:46	10:52	186	8	8	8	1488	4	100	0.002	<LOD	N/A
Area	007	B4 south area	10:50	13:47	177	8	8	8	1416	5	100	0.002	0.002	N/A
Area	008	B4 - Center area adjacent regulated area	10:51	13:48	177	8	8	8	1416	4.5	100	0.002	0.002	N/A
Area	009	Truck wash	10:52	13:49	177	8	8	8	1416	4	100	0.002	<LOD	N/A
Area	010	North area at gate D	10:53	13:50	177	8	8	8	1416	3.5	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A


Analysis Information

Analyst	David Adams	Analysis Date	08/04/2023
Analyst Signature			

Project Name	776 Summer Street (1898 9" X 9" VAT) Power Plant	Sample Date	08/02/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 1A 1898 West	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	1898 North area at hepa exhaust	10:17	13:40	203	8	8	8	1624	4	100	0.002	<LOD	N/A
Area	004	1898 center area at decon	10:19	13:41	202	8	8	8	1616	3	100	0.002	<LOD	N/A
Background	005	1898 south area at light pole	10:19	13:42	203	8	8	8	1624	3.5	100	0.002	<LOD	N/A
Area	006	1898 southeast area of containment	10:20	13:43	203	8	8	8	1624	2.5	100	0.002	<LOD	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	08/02/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (1898 9" X 9" VAT) Power Plant	Sample Date	08/03/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 1A 1898 West	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	1898 North area at hepa exhaust	07:40	10:39	179	8	8	8	1432	8	100	0.002	0.003	N/A
Background	004	1898 center area at decon	07:41	10:40	179	8	8	8	1432	6.5	100	0.002	0.002	N/A
Area	005	1898 south area at light pole	07:42	10:41	179	8	8	8	1432	7.5	100	0.002	0.003	N/A
Area	006	1898 southeast area of containment	07:43	10:42	179	8	8	8	1432	5.5	100	0.002	0.002	N/A
Area	007	1898 North area at hepa exhaust	10:39	13:38	179	8	8	8	1432	7	100	0.002	0.002	N/A
Area	008	1898 center area at decon	10:40	13:39	179	8	8	8	1432	8	100	0.002	0.003	N/A
Background	009	1898 south area at light pole	10:41	13:40	179	8	8	8	1432	7.5	100	0.002	0.003	N/A
Area	010	1898 southeast area of containment	10:42	13:41	179	8	8	8	1432	5	100	0.002	0.002	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	08/03/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (1898 9" X 9" VAT) Power Plant	Sample Date	08/04/2023
TRC Project #	474824	Sampling Technician	Diana Carolina Saune Barrientos
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 1A 1898 West	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	1898 North area at hepa exhaust	07:00	11:00	240	8	8	8	1920	5	100	0.001	0.001	N/A
Background	004	1898 center area at decon	07:02	11:02	240	8	8	8	1920	4	100	0.001	0.001	N/A
Area	005	1898 south area at light pole	07:04	11:04	240	8	8	8	1920	4.5	100	0.001	0.001	N/A
Area	006	1898 southeast area of containment	07:06	11:06	240	8	8	8	1920	5.5	100	0.001	0.001	N/A
Area	007	1898 North area at hepa exhaust	11:00	14:00	180	8	8	8	1440	3.5	100	0.002	<LOD	N/A
Area	008	1898 center area at decon	11:02	14:02	180	8	8	8	1440	3.5	100	0.002	<LOD	N/A
Background	009	1898 south area at light pole	11:04	14:04	180	8	8	8	1440	2	100	0.002	<LOD	N/A
Area	010	1898 southeast area of containment	11:06	14:06	180	8	8	8	1440	4	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information


Analyst	Diana Carolina Saune Barrientos	Analysis Date	08/04/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS

Project Name	776 Summer Street (TH3 Platform)(Power Plant)	Sample Date	08/09/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Turbine Hall 3	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	North area	11:37	14:09	152	8	8	8	1216	11.5	100	0.002	0.005	N/A
Area	004	Northeast area	11:38	14:10	152	8	8	8	1216	7.5	100	0.002	0.003	N/A
Area	005	Southeast area	11:39	14:11	152	8	8	8	1216	8.5	100	0.002	0.003	N/A
Area	006	South area at scaffolding	11:40	14:12	152	8	8	8	1216	4	100	0.002	0.002	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information


Analyst	David Adams		
Analyst Signature		Analysis Date	08/09/2023

ASBESTOS AIR SAMPLE RESULTS

Project Name	776 Summer Street (Background Sampling)	Sample Date	08/05/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Various Sites	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	B3 center area of old reg. area 1 summer Street sidewalk at water cannon	07:52	10:01	129	10	10	10	1290	12	100	0.002	0.005	N/A
Background	004	B3 northwest corner of old reg area 1 summer Street sidewalk	07:53	10:02	129	10	10	10	1290	10.5	100	0.002	0.004	N/A
Background	005	B3 Northeast area of old reg. area 1	07:55	10:04	129	10	10	10	1290	6.5	100	0.002	0.002	N/A
Background	006	B3 North area of North yard	07:56	10:06	130	10	10	10	1300	5	100	0.002	0.002	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	08/05/2023
Analyst Signature			


Project Name	776 Summer Street (Background Sampling)	Sample Date	08/07/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Various Sites	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	B4 - Center area at truck wash	07:18	10:22	184	8	8	8	1472	6.5	100	0.002	0.002	N/A
Background	004	B4 - North area at building 3 corner	07:19	10:23	184	8	8	8	1472	4	100	0.002	<LOD	N/A
Background	005	B3 center of area 1 at summer Street sidewalk	07:20	10:24	184	8	8	8	1472	6	100	0.002	0.002	N/A
Background	006	East 1st St. - Turbine hall 3 roof at base of scaffolding	07:26	10:29	183	8	8	8	1464	3	100	0.002	<LOD	N/A
Background	007	East 1st St - gate E at water shed	07:31	10:34	183	8	8	8	1464	2.5	100	0.002	<LOD	N/A
Background	008	East 1st St. - West of Suffolk at dust monitor	07:32	10:35	183	8	8	8	1464	4.5	100	0.002	0.002	N/A
Background	009	B4 - Center area at truck wash	10:22	13:38	196	8	8	8	1568	4.5	100	0.002	<LOD	N/A
Background	010	B4 - North area at building 3 corner	10:23	13:39	196	8	8	8	1568	3.5	100	0.002	<LOD	N/A
Background	011	B3 center of area 1 at summer Street sidewalk	10:24	13:40	196	8	8	8	1568	3.5	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	012	East 1st St. - Turbine hall 3 roof at base of scaffolding	10:29	13:46	197	8	8	8	1576	5.5	100	0.002	0.002	N/A
Background	013	East 1st St - gate E at water shed	10:34	13:51	197	8	8	8	1576	3	100	0.002	<LOD	N/A
Background	014	East 1st St. - West of Suffolk at dust monitor	10:35	13:52	197	8	8	8	1576	5.5	100	0.002	0.002	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	08/07/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (Background Sampling)	Sample Date	08/08/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Various Sites	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	B4 - Center area at truck wash	07:17	10:24	187	8	8	8	1496	6.5	100	0.002	0.002	N/A
Background	004	B4 - North area at building 3 corner	07:18	10:25	187	8	8	8	1496	5.5	100	0.002	0.002	N/A
Background	006	East 1st St. - Turbine hall 3 roof at base of scaffolding	07:25	10:37	192	8	8	8	1536	3.5	100	0.002	<LOD	N/A
Background	007	East 1st St - gate E at water shed	07:30	10:42	192	8	8	8	1536	5	100	0.002	0.002	N/A
Background	008	East 1st St. - West of Suffolk at dust monitor	07:31	10:43	192	8	8	8	1536	4.5	100	0.002	<LOD	N/A
Background	012	East 1st St. - Turbine hall 3 roof at base of scaffolding	10:37	13:47	190	8	8	8	1520	1.5	100	0.002	<LOD	N/A
Background	013	East 1st St - gate E at water shed	10:42	13:52	190	8	8	8	1520	3	100	0.002	<LOD	N/A
Background	014	East 1st St. - West of Suffolk at dust monitor	10:43	13:53	190	8	8	8	1520	2.5	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	08/08/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (Background Sampling)	Sample Date	08/09/2023
TRC Project #	474824	Sampling Technician	Diana Carolina Saune Barrientos
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Various Sites	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	B3 center of area 1 at summer Street sidewalk	07:00	11:00	240	8	8	8	1920	6	100	0.001	0.002	N/A
Background	005	B4 - North area at gate D	07:12	11:12	240	8	8	8	1920	6.5	100	0.001	0.002	N/A
Background	006	B4 - Center area at truck wash	07:14	11:14	240	8	8	8	1920	7	100	0.001	0.002	N/A
Background	007	East 1st St - gate E at water shed	07:25	11:25	240	8	8	8	1920	7	100	0.001	0.002	N/A
Background	008	East 1st St. - West of Suffolk at dust monitor	07:27	11:27	240	8	8	8	1920	2	100	0.001	0.001	N/A
Background	009	B4 - Center area at truck wash	11:14	13:50	156	8	8	8	1248	7.5	100	0.002	0.003	N/A
Background	010	B4 North area at gate D	11:12	13:51	159	8	8	8	1272	13.5	100	0.002	0.005	N/A
Background	011	B3 - west area at summer Street sidewalk at gate C	11:02	13:53	171	8	8	8	1368	6.5	100	0.002	0.002	N/A
Background	012	B3 center of area 1 at summer Street sidewalk	11:00	13:54	174	8	8	8	1392	5.5	100	0.002	0.002	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	013	East 1st St - gate E at water shed	11:25	14:01	156	8	8	8	1248	3.5	100	0.002	<LOD	N/A
Area	014	East 1st St. - West of Suffolk at dust monitor	11:27	14:02	155	8	8	8	1240	4.5	100	0.002	0.002	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	Diana Carolina Saune Barrientos	Analysis Date	08/09/2023
Analyst Signature			


ASBESTOS AIR SAMPLE RESULTS

Project Name		776 Summer Street (Background Sampling)					Sample Date		08/10/2023					
TRC Project #		474824					Sampling Technician		Scott Stockwell					
Client		HRP 776 Summer Street PropCo LLC					Laboratory		TRC					
Facility Name		Various Sites					Sample/Analysis Method		NIOSH 7400					
Facility Location		776 Summer Street, Boston, Massachusetts					Sampling Type		PCM					
Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	B3 - center at summer street sidewalk	07:15	10:15	180	8	8	8	1440	4.5	100	0.002	0.002	N/A
Background	004	B3 - west at summer Street sidewalk	07:17	10:19	182	8	8	8	1456	6	100	0.002	0.002	N/A
Background	005	B3 - north by generator in yard	07:21	10:25	184	8	8	8	1472	6.5	100	0.002	0.002	N/A
Background	006	B4 - north area at gate D	07:25	10:31	186	8	8	8	1488	5	100	0.002	0.002	N/A
Background	007	B4 - center at truck wash station	07:27	10:35	188	8	8	8	1504	7	100	0.002	0.002	N/A
Background	008	East 1st St - gate E at water shed	07:34	10:44	190	8	8	8	1520	5	100	0.002	0.002	N/A
Background	009	East 1st St. - West of Suffolk at dust monitor	07:36	10:48	192	8	8	8	1536	2.5	100	0.002	<LOD	N/A
Background	010	B4 - center north regulated area in yard	10:00	13:10	190	8	8	8	1520	4.5	100	0.002	<LOD	N/A
Background	011	B4 - center west regulated area in yard	10:02	13:12	190	8	8	8	1520	6	100	0.002	0.002	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	012	B3 - center at summer street sidewalk	10:17	13:30	193	8	8	8	1544	6.5	100	0.002	0.002	N/A
Background	013	B3 - west at summer street sidewalk	10:21	13:32	191	8	8	8	1528	7.5	100	0.002	0.002	N/A
Background	014	B3 - north by generator in yard	10:27	13:36	189	8	8	8	1512	7	100	0.002	0.002	N/A
Background	015	B4 - north area at gate D	10:33	13:40	187	8	8	8	1496	6.5	100	0.002	0.002	N/A
Background	016	B4 - center at truck wash station	10:37	13:42	185	8	8	8	1480	6.5	100	0.002	0.002	N/A
Background	017	East 1st St - gate E at water shed	10:46	13:49	183	8	8	8	1464	6	100	0.002	0.002	N/A
Background	018	East 1st St. - West of Suffolk at dust monitor	10:50	13:51	181	8	8	8	1448	1.5	100	0.002	<LOD	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	Scott Stockwell	Analysis Date	08/10/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS

Project Name		776 Summer Street (Background Sampling)					Sample Date		08/11/2023					
TRC Project #		474824					Sampling Technician		Scott Stockwell					
Client		HRP 776 Summer Street PropCo LLC					Laboratory		TRC					
Facility Name		Various Sites					Sample/Analysis Method		NIOSH 7400					
Facility Location		776 Summer Street, Boston, Massachusetts					Sampling Type		PCM					
Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	B3 - center at summer street sidewalk	07:10	10:10	180	8	8	8	1440	5	100	0.002	0.002	N/A
Background	004	B3 - west at summer Street sidewalk	07:12	10:14	182	8	8	8	1456	7	100	0.002	0.002	N/A
Background	005	B3 - north by generator in yard	07:15	10:19	184	8	8	8	1472	5.5	100	0.002	0.002	N/A
Background	006	B4 - north area at gate D	07:18	10:24	186	8	8	8	1488	6.5	100	0.002	0.002	N/A
Background	007	B4 - center at truck wash station	07:20	10:28	188	8	8	8	1504	5.5	100	0.002	0.002	N/A
Background	008	B4 - center north regulated area in yard	07:22	10:32	190	8	8	8	1520	5	100	0.002	0.002	N/A
Background	009	B4 - center west regulated area in yard	07:24	10:36	192	8	8	8	1536	5.5	100	0.002	0.002	N/A
Background	010	East 1st St - gate E at water shed	07:31	10:45	194	8	8	8	1552	6	100	0.002	0.002	N/A
Background	011	East 1st St. - West of Suffolk at dust monitor	07:33	10:49	196	8	8	8	1568	3.5	100	0.002	<LOD	N/A


ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	012	B3 - center at summer street sidewalk	10:12	13:20	188	8	8	8	1504	7	100	0.002	0.002	N/A
Background	013	B3 - west at summer Street sidewalk	10:16	13:22	186	8	8	8	1488	8	100	0.002	0.003	N/A
Background	014	B3 - north by generator in yard	10:21	13:25	184	8	8	8	1472	6.5	100	0.002	0.002	N/A
Background	015	B4 - north area at gate D	10:26	13:28	182	8	8	8	1456	6	100	0.002	0.002	N/A
Background	016	B4 - center at truck wash station	10:30	13:30	180	8	8	8	1440	7	100	0.002	0.002	N/A
Background	017	B4 - center north regulated area in yard	10:34	13:32	178	8	8	8	1424	4	100	0.002	<LOD	N/A
Background	018	B4 - center west regulated area in yard	10:38	13:34	176	8	8	8	1408	6.5	100	0.002	0.002	N/A
Background	019	East 1st St - gate E at water shed	10:47	13:41	174	8	8	8	1392	5	100	0.002	0.002	N/A
Background	020	East 1st St. - West of Suffolk at dust monitor	10:51	13:43	172	8	8	8	1376	2	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information


Analyst	Scott Stockwell	Analysis Date	08/11/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS

Project Name	776 Summer Street (Power Plant) (Turbine Hall 3 Roof Platform)	Sample Date	08/10/2023
TRC Project #	474824	Sampling Technician	Scott Stockwell
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	South Boston Power Plant	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, MA	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	Turbine Hall 3 Roof north area	07:40	09:20	100	8	8	8	800	2.5	100	0.003	<LOD	N/A
Background	004	Turbine Hall 3 Roof east area	07:42	09:22	100	8	8	8	800	3.5	100	0.003	<LOD	N/A
Background	005	Turbine Hall 3 Roof south area	07:44	09:24	100	8	8	8	800	2	100	0.003	<LOD	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information


Analyst	Scott Stockwell	Analysis Date	08/10/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS

Project Name	776 Summer Street (Power Plant) (Turbine Hall 3 Roof Platform)	Sample Date	08/11/2023
TRC Project #	474824	Sampling Technician	Scott Stockwell
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	South Boston Power Plant	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, MA	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	Turbine Hall 3 Roof north area	06:55	08:00	65	8	8	8	520	1.5	100	0.005	<LOD	N/A
Background	004	Turbine Hall 3 Roof east area	06:57	08:02	65	8	8	8	520	3	100	0.005	<LOD	N/A
Background	005	Turbine Hall 3 Roof south area	06:59	08:04	65	8	8	8	520	2	100	0.005	<LOD	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	Scott Stockwell	Analysis Date	08/11/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (Elevator Shaft Panels)(Power Plant)	Sample Date	08/15/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 3	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	Southwest area	08:01	10:43	162	8	8	8	1296	4.5	100	0.002	0.002	N/A
Area	004	Northwest area phase 3 bldg 3	08:02	10:44	162	8	8	8	1296	3.5	100	0.002	<LOD	N/A
Area	005	Northeast area	08:04	10:46	162	8	8	8	1296	4	100	0.002	0.002	N/A
Area	006	Southeast	08:05	10:47	162	8	8	8	1296	2.5	100	0.002	<LOD	N/A
Area	007	Southwest area	10:43	13:28	165	8	8	8	1320	4	100	0.002	<LOD	N/A
Area	008	Northwest area	10:44	13:30	166	8	8	8	1328	4	100	0.002	<LOD	N/A
Area	009	Northeast area	10:46	13:31	165	8	8	8	1320	6	100	0.002	0.002	N/A
Area	010	Southeast area	10:47	13:33	166	8	8	8	1328	4.5	100	0.002	0.002	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	08/15/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS

Project Name	776 Summer Street (Background Sampling)	Sample Date	08/12/2023
TRC Project #	474824	Sampling Technician	Scott Stockwell
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4 Yard	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	B3 - center at summer street sidewalk	06:40	09:45	185	8	8	8	1480	4	100	0.002	<LOD	N/A
Background	004	B3 - west at summer Street sidewalk	06:42	09:49	187	8	8	8	1496	5.5	100	0.002	0.002	N/A
Background	005	B3 - north by generator in yard	06:46	09:55	189	8	8	8	1512	6	100	0.002	0.002	N/A
Background	006	B4 - north area at gate D	06:50	10:01	191	8	8	8	1528	6	100	0.002	0.002	N/A
Background	007	B4 - center at truck wash station	06:52	10:05	193	8	8	8	1544	4	100	0.002	<LOD	N/A
Background	008	B4 - center north regulated area in yard	06:55	10:10	195	8	8	8	1560	4.5	100	0.002	<LOD	N/A
Background	009	B4 - center west regulated area in yard	06:57	10:14	197	8	8	8	1576	5	100	0.002	0.002	N/A
Background	010	East 1st St - gate E at water shed	07:04	10:23	199	8	8	8	1592	5.5	100	0.002	0.002	N/A
Background	011	East 1st St. - West of Suffolk at dust monitor	07:06	10:27	201	8	8	8	1608	3	100	0.002	<LOD	N/A


ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	012	B3 - center at summer street sidewalk	09:47	12:45	178	8	8	8	1424	4.5	100	0.002	0.002	N/A
Background	013	B3 - west at summer Street sidewalk	09:51	12:47	176	8	8	8	1408	7	100	0.002	0.002	N/A
Background	014	B3 - north by generator in yard	09:57	12:51	174	8	8	8	1392	7	100	0.002	0.002	N/A
Background	015	B4 - north area at gate D	10:03	12:55	172	8	8	8	1376	7.5	100	0.002	0.003	N/A
Background	016	B4 - center at truck wash station	10:07	12:57	170	8	8	8	1360	5	100	0.002	0.002	N/A
Background	017	B4 - center north regulated area in yard	10:12	13:00	168	8	8	8	1344	5.5	100	0.002	0.002	N/A
Background	018	B4 - center west regulated area in yard	10:16	13:02	166	8	8	8	1328	6.5	100	0.002	0.002	N/A
Background	019	East 1st St - gate E at water shed	10:25	13:09	164	8	8	8	1312	6.5	100	0.002	0.002	N/A
Background	020	East 1st St. - West of Suffolk at dust monitor	10:29	13:11	162	8	8	8	1296	2	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	Scott Stockwell	Analysis Date	08/12/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (Background Sampling)	Sample Date	08/14/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4 Yard	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	B4 - Center area at truck wash	07:19	10:38	199	8	8	8	1592	4.5	100	0.002	<LOD	N/A
Background	004	B4 North area at gate D	07:20	10:39	199	8	8	8	1592	6	100	0.002	0.002	N/A
Background	005	B3 - west area at summer Street sidewalk at gate C	07:21	10:40	199	8	8	8	1592	5	100	0.002	0.002	N/A
Background	006	B3 center of area 1 at summer Street sidewalk	07:22	10:41	199	8	8	8	1592	3.5	100	0.002	<LOD	N/A
Background	007	East 1st St - gate E at water shed	07:28	10:42	194	8	8	8	1552	5.5	100	0.002	0.002	N/A
Background	008	East 1st St. - West of Suffolk at dust monitor	07:29	10:48	199	8	8	8	1592	4.5	100	0.002	<LOD	N/A
Background	009	B4 - Center area at truck wash	10:38	13:52	194	8	8	8	1552	3.5	100	0.002	<LOD	N/A
Background	010	B4 North area at gate D	10:39	13:53	194	8	8	8	1552	6	100	0.002	0.002	N/A
Background	011	B3 - west area at summer Street sidewalk at gate C	10:40	13:54	194	8	8	8	1552	5	108	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	012	B3 center of area 1 at summer Street sidewalk	10:41	13:55	194	8	8	8	1552	7.5	100	0.002	0.002	N/A
Background	013	East 1st St - gate E at water shed	10:47	14:01	194	8	8	8	1552	3	100	0.002	<LOD	N/A
Background	014	East 1st St. - West of Suffolk at dust monitor	10:48	14:02	194	8	8	8	1552	6	100	0.002	0.002	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	08/14/2023
Analyst Signature			


ASBESTOS AIR SAMPLE RESULTS

Project Name		776 Summer Street (Background Sampling)					Sample Date		08/15/2023					
TRC Project #		474824					Sampling Technician		David Adams					
Client		HRP 776 Summer Street PropCo LLC					Laboratory		TRC					
Facility Name		Building 4 Yard					Sample/Analysis Method		NIOSH 7400					
Facility Location		776 Summer Street, Boston, Massachusetts					Sampling Type		PCM					
Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	B4 - Center area at truck wash	10:52	13:38	166	8	8	8	1328	3	100	0.002	<LOD	N/A
Background	004	B4 North area at gate D	10:53	13:39	166	8	8	8	1328	5	100	0.002	0.002	N/A
Background	005	B3 - west area at summer Street sidewalk at gate C	10:54	13:40	166	8	8	8	1328	5.5	100	0.002	0.002	N/A
Background	006	B3 center of area 1 at summer Street sidewalk	10:55	13:41	166	8	8	8	1328	4	100	0.002	<LOD	N/A
Background	007	East 1st St - gate E at water shed	11:00	13:46	166	8	8	8	1328	4.5	100	0.002	0.002	N/A
Background	008	East 1st St. - West of Suffolk at dust monitor	11:01	13:47	166	8	8	8	1328	4.5	100	0.002	0.002	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	08/15/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (Background Sampling)	Sample Date	08/16/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4 Yard	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	B4 - Center area at truck wash	07:17	10:33	196	8	8	8	1568	4.5	100	0.002	<LOD	N/A
Background	004	B4 North area at gate D	07:18	10:34	196	8	8	8	1568	6.5	100	0.002	<LOD	N/A
Background	005	B3 - west area at summer Street sidewalk at gate C	07:20	10:36	196	8	8	8	1568	5	100	0.002	<LOD	N/A
Background	006	B3 center of area 1 at summer Street sidewalk	07:21	10:37	196	8	8	8	1568	7	100	0.002	<LOD	N/A
Background	007	East 1st St - gate E at water shed	07:26	10:43	197	8	8	8	1576	3	100	0.002	<LOD	N/A
Background	008	East 1st St. - West of Suffolk at dust monitor	07:27	10:44	197	8	8	8	1576	5.5	100	0.002	<LOD	N/A
Background	009	B3 - west area at summer Street sidewalk at gate C	10:36	13:43	187	8	8	8	1496	5.5	100	0.002	<LOD	N/A
Background	010	B3 center of area 1 at summer Street sidewalk	10:37	13:44	187	8	8	8	1496	6	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	011	East 1st St - gate E at water shed	10:43	13:49	186	8	8	8	1488	4.5	100	0.002	<LOD	N/A
Background	012	East 1st St. - West of Suffolk at dust monitor	10:44	13:50	186	8	8	8	1488	6	100	0.002	<LOD	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	9	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	08/16/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (Background Sampling)	Sample Date	08/17/2023
TRC Project #	474824	Sampling Technician	Diana Carolina Saune Barrientos
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4 Yard	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	B3 - west area at summer Street sidewalk at gate C	07:00	11:00	240	8	8	8	1920	6	100	0.001	0.002	N/A
Background	004	B3 center of area 1 at summer Street sidewalk	07:02	11:02	240	8	8	8	1920	5.5	100	0.001	0.001	N/A
Background	005	East 1st St - gate E at water shed	07:15	11:15	240	8	8	8	1920	6	100	0.001	0.002	N/A
Background	006	East 1st St. - West of Suffolk at dust monitor	07:17	11:17	240	8	8	8	1920	4	100	0.001	0.001	N/A
Background	007	B3 - west area at summer Street sidewalk at gate C	11:00	13:40	160	8	8	8	1280	7	100	0.002	0.003	N/A
Background	008	B3 center of area 1 at summer Street sidewalk	11:04	13:44	160	8	8	8	1280	4	100	0.002	0.002	N/A
Background	009	East 1st St - gate E at water shed	11:15	14:00	165	8	8	8	1320	3.5	100	0.002	<LOD	N/A
Background	010	East 1st St. - West of Suffolk at dust monitor	11:17	14:02	165	8	8	8	1320	4	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	Diana Carolina Saune Barrientos	Analysis Date	08/17/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (Background Sampling)	Sample Date	08/18/2023
TRC Project #	474824	Sampling Technician	Diana Carolina Saune Barrientos
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4 Yard	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	B3 - west area at summer Street sidewalk at gate C	07:00	11:00	240	8	8	8	1920	0	100	0.001	<LOD	N/A
Background	004	B3 center of area 1 at summer Street sidewalk	07:02	11:02	240	8	8	8	1920	1	100	0.001	<LOD	N/A
Background	005	East 1st St - gate E at water shed	07:15	11:15	240	8	8	8	1920	1.5	100	0.001	<LOD	N/A
Background	006	East 1st St. - West of Suffolk at dust monitor	07:17	11:17	240	8	8	8	1920	2	100	0.001	0.001	N/A
Background	010	East 1st St. - West of Suffolk at dust monitor	11:17	14:02	165	8	8	8	1320	4	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information


Analyst	Diana Carolina Saune Barrientos	Analysis Date	08/18/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS

Project Name	776 Summer Street (Steam Drum Tank) Power Plant	Sample Date	08/16/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	B4 south area	11:18	13:56	158	8	8	8	1264	5.5	100	0.002	0.002	N/A
Area	004	B4 across from Cornice	11:19	13:57	158	8	8	8	1264	3.5	100	0.002	<LOD	N/A
Area	005	B4 - Center area at truck wash	11:20	13:58	158	8	8	8	1264	6	100	0.002	0.002	N/A
Area	006	B4 North area at gate D	23:21	13:59	878	8	8	8	7024	4.5	100	0	0	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams		
Analyst Signature		Analysis Date	08/16/2023


ASBESTOS AIR SAMPLE RESULTS

Project Name		776 Summer Street (Steam Drum Tank) Power Plant					Sample Date		08/17/2023					
TRC Project #		474824					Sampling Technician		David Adams					
Client		HRP 776 Summer Street PropCo LLC					Laboratory		TRC					
Facility Name		Building 4					Sample/Analysis Method		NIOSH 7400					
Facility Location		776 Summer Street, Boston, Massachusetts					Sampling Type		PCM					
Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	SD - South area at break in brick wall	07:39	10:43	184	8	8	8	1472	7.5	100	0.002	0.002	N/A
Area	004	SD - hay bail across from Cornice drop area	07:40	10:44	184	8	8	8	1472	11.5	100	0.002	0.004	N/A
Area	005	SD - center truck wash	07:41	10:45	184	8	8	8	1472	4.5	100	0.002	<LOD	N/A
Area	006	SD - gate D at north truck wash	07:42	10:46	184	8	8	8	1472	6.5	100	0.002	0.002	N/A
Area	007	SD - South area at break in brick wall	10:43	13:45	182	8	8	8	1456	15.5	100	0.002	0.005	N/A
Area	008	SD - hay bail across from Cornice drop area	10:44	13:46	182	8	8	8	1456	8.5	100	0.002	0.003	N/A
Area	009	SD - center truck wash	10:45	13:47	182	8	8	8	1456	5	100	0.002	0.002	N/A
Area	010	SD - gate D at north truck wash	10:46	13:48	182	8	8	8	1456	5.5	100	0.002	0.002	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information


Analyst	David Adams	Analysis Date	08/17/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS

Project Name	776 Summer Street (Steam Drum Tank) Power Plant	Sample Date	08/18/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	SD - South area at break in brick wall	07:39	10:40	181	8	8	8	1448	5.5	100	0.002	0.002	N/A
Area	004	SD - hay bail across from Cornice drop area	07:40	10:41	181	8	8	8	1448	4	100	0.002	<LOD	N/A
Area	005	SD - center truck wash	07:41	10:42	181	8	8	8	1448	3.5	100	0.002	<LOD	N/A
Area	006	SD - gate D at north truck wash	07:42	10:43	181	8	8	8	1448	3	100	0.002	<LOD	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	10	N/A	N/A	N/A

Analysis Information

Analyst	David Adams		
Analyst Signature		Analysis Date	08/18/2023

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (Steam Drum - Amendment 10)(Power Plant)	Sample Date	08/21/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	4 - southwest area at HEPA exhaust	07:49	10:39	170	8	8	8	1360	4.5	100	0.002	0.002	N/A
Area	004	4 - northwest area at decon	07:50	10:40	170	8	8	8	1360	5	100	0.002	0.002	N/A
Area	005	4 - northeast area at loadout	07:51	10:41	170	8	8	8	1360	4	100	0.002	<LOD	N/A
Area	006	4 - southeast area of containment across from debris	07:52	10:42	170	8	8	8	1360	7.5	100	0.002	0.003	N/A
Area	007	4 - south area at wall knockout	10:38	13:44	186	8	8	8	1488	5.5	100	0.002	0.002	N/A
Area	008	4 - southwest area at HEPA exhaust	10:39	13:45	186	8	8	8	1488	4.5	100	0.002	<LOD	N/A
Area	009	4 - northwest area at decon	10:40	13:46	186	8	8	8	1488	5	100	0.002	0.002	N/A
Area	010	4 - northeast area at loadout	10:41	13:47	186	8	8	8	1488	4.5	108	0.002	<LOD	N/A
Area	011	4 - southeast area of containment across from debris	10:42	13:48	186	8	8	8	1488	5	100	0.002	0.002	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	10	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	08/21/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (Steam Drum - Amendment 10)(Power Plant)	Sample Date	08/22/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	4 - south area at wall knockout	07:35	10:43	188	8	8	8	1504	3	108	0.002	<LOD	N/A
Area	004	4 - southwest area at HEPA exhaust	07:36	10:44	188	8	8	8	1504	4.5	100	0.002	<LOD	N/A
Area	005	4 - southeast area of containment across from debris	07:37	10:45	188	8	8	8	1504	5.5	100	0.002	0.002	N/A
Area	006	3 - northeast area of west wall at generator	07:38	10:46	188	8	8	8	1504	5	100	0.002	0.002	N/A
Area	007	4 - northwest area at decon	07:39	10:47	188	8	8	8	1504	8.5	100	0.002	0.003	N/A
Area	008	4 - south area at wall knockout	10:43	14:02	199	8	8	8	1592	4	100	0.002	<LOD	N/A
Area	009	4 - southwest area at HEPA exhaust	10:44	14:03	199	8	8	8	1592	6	100	0.002	0.002	N/A
Area	010	4 - southeast area of containment across from debris	10:45	14:04	199	8	8	8	1592	6.5	100	0.002	0.002	N/A
Area	011	4 - northeast area at loadout	10:46	14:05	199	8	8	8	1592	5.5	100	0.002	0.002	N/A
Area	012	4 - northwest area at decon	10:47	14:06	199	8	8	8	1592	7.5	10	0.017	0.023	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	08/22/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (Steam Drum - Amendment 10)(Power Plant)	Sample Date	08/23/2023
TRC Project #	474824	Sampling Technician	Diana Carolina Saune Barrientos
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	4 - south area at wall knockout	07:00	11:00	240	8	8	8	1920	7	100	0.001	0.002	N/A
Area	004	4 - southwest area at HEPA exhaust	07:02	11:02	240	8	8	8	1920	1.5	100	0.001	<LOD	N/A
Area	005	4 - southeast area of containment across from debris	07:06	11:06	240	8	8	8	1920	1	100	0.001	<LOD	N/A
Area	006	3 - northeast area of west wall at generator	07:08	11:08	240	8	8	8	1920	3	100	0.001	0.001	N/A
Area	007	4 - south area at wall knockout	11:01	14:30	209	8	8	8	1672	5	100	0.002	<LOD	N/A
Area	008	4 - southwest area at HEPA exhaust	11:03	02:35	932	8	8	8	7456	3	100	0	0	N/A
Area	009	4 - southeast area of containment across from debris	11:07	14:37	210	8	8	8	1680	1.5	100	0.002	<LOD	N/A
Area	010	3 - northeast area of west wall at generator	11:09	14:40	211	8	8	8	1688	4.5	100	0.002	<LOD	N/A
Area	011	North B4- Generator	11:20	14:30	190	8	8	8	1520	2.5	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	Diana Carolina Saune Barrientos	Analysis Date	08/23/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (Steam Drum - Amendment 10)(Power Plant)	Sample Date	08/24/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	4 - south area at wall knockout	07:43	10:52	189	8	8	8	1512	5	100	0.002	0.002	N/A
Area	004	4 - southwest area at HEPA exhaust	07:44	10:53	189	8	8	8	1512	4.5	100	0.002	<LOD	N/A
Area	005	4 - southeast area of containment across from debris	07:45	10:54	189	8	8	8	1512	3.5	100	0.002	<LOD	N/A
Area	006	4 - northeast area at loadout	07:46	10:55	189	8	8	8	1512	5.5	100	0.002	0.002	N/A
Area	007	4 - northwest area at decon	07:47	10:56	189	8	8	8	1512	6	100	0.002	0.002	N/A
Clearance	008	4 South area inside containment at hepa units	12:47	14:30	103	12	12	12	1236	3	100	0.002	<LOD	N/A
Clearance	009	4 North area inside containment at loadout	12:48	14:31	103	12	12	12	1236	2.5	100	0.002	<LOD	N/A
Area	010	4 - south area at wall knockout	10:52	13:50	178	8	8	8	1424	4.5	100	0.002	0.002	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	011	4 - southeast area of containment across from debris	10:54	13:51	177	8	8	8	1416	3	100	0.002	<LOD	N/A
Area	012	4 - northeast area at loadout	10:55	13:52	177	8	8	8	1416	6	100	0.002	0.002	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

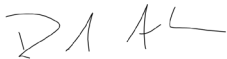
Analysis Information

Analyst	David Adams	Analysis Date	08/24/2023
Analyst Signature			

Project Name	776 Summer Street (Steam Drum - Amendment 10)(Power Plant)	Sample Date	08/25/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	4 - south area at wall knockout	10:23	13:13	170	8	8	8	1360	3.5	100	0.002	<LOD	N/A
Area	005	4 - southeast area of containment across from debris pile	10:25	13:15	170	8	8	8	1360	1.5	100	0.002	<LOD	N/A
Area	004	4 beginning of brick wall at sidewalk	10:24	13:14	170	8	8	8	1360	2.5	100	0.002	<LOD	N/A
Area	006	4 east area between amendment 10 & 11	10:26	13:16	170	8	8	8	1360	2.5	100	0.002	<LOD	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	08/25/2023
Analyst Signature			


ASBESTOS AIR SAMPLE RESULTS

Project Name		776 Summer Street (Building 3 Phase 3 & West Wall Flashing Cement)(Power Plant)				Sample Date		08/21/2023						
TRC Project #		474824				Sampling Technician		David Adams						
Client		HRP 776 Summer Street PropCo LLC				Laboratory		TRC						
Facility Name		Building 3				Sample/Analysis Method		NIOSH 7400						
Facility Location		776 Summer Street, Boston, Massachusetts				Sampling Type		PCM						
Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	3 - northwest area of west wall on summer street sidewalk	19:42	22:32	170	8	8	8	1360	7	100	0.002	0.003	N/A
Area	004	3 - northeast area of west wall at generator	07:43	10:33	170	8	8	8	1360	4.5	100	0.002	0.002	N/A
Area	005	3 - southeast area of west wall at corner of 101 phase 3	07:46	10:36	170	8	8	8	1360	6	100	0.002	0.002	N/A
Area	006	3 southwest area of west wall at gate D	07:47	10:37	170	8	8	8	1360	6.5	100	0.002	0.002	Northst ar stopped work in this area around 10am.

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	08/21/2023
Analyst Signature			


Project Name	776 Summer Street (Building 3 Phase 3 & West Wall Flashing Cement)(Power Plant)	Sample Date	08/22/2023
TRC Project #	474824	Sampling Technician	Diana Carolina Saune Barrientos
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 3	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	3 - northwest area of west wall on summer street sidewalk	06:30	11:00	270	8	8	8	2160	2	100	0.001	<LOD	N/A
Area	004	3 - northeast area of west wall at generator	06:40	11:10	270	8	8	8	2160	3	100	0.001	0.001	N/A
Area	005	3 - southeast area of west wall at corner of 101 phase 3	06:45	11:15	270	8	8	8	2160	4	100	0.001	0.001	N/A
Area	006	3 southwest area of west wall at gate D	06:55	11:25	270	8	8	8	2160	2.5	100	0.001	0.001	N/A
Area	007	3 - northwest area of west wall on summer street sidewalk	11:01	14:30	209	8	8	8	1672	1.5	100	0.002	<LOD	N/A
Area	008	3 - northeast area of west wall at generator	11:11	14:40	209	8	8	8	1672	2	100	0.002	<LOD	N/A
Area	009	3 - southeast area of west wall at corner of 101 phase 3	11:16	14:46	210	8	8	8	1680	3	100	0.002	<LOD	N/A
Area	010	3 southwest area of west wall at gate D	11:26	14:56	210	8	8	8	1680	4.5	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	Diana Carolina Saune Barrientos	Analysis Date	08/22/2023
Analyst Signature			


Project Name	776 Summer Street (Building 3 Phase 3 & West Wall Flashing Cement)(Power Plant)	Sample Date	08/23/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 3	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	3 - northwest area of west wall on summer street sidewalk	07:33	10:47	194	8	8	8	1552	7.5	100	0.002	0.002	N/A
Area	004	3 - northeast area of west wall at generator	07:35	10:49	194	8	8	8	1552	3.5	100	0.002	<LOD	N/A
Area	005	3 - southeast area of west wall at corner of 101 phase 3	07:37	10:51	194	8	8	8	1552	6.5	100	0.002	0.002	N/A
Area	006	3 southwest area of west wall at gate D	07:38	10:52	194	8	8	8	1552	5.5	100	0.002	0.002	N/A
Area	007	3 - northwest area of west wall on summer street sidewalk	10:47	14:04	197	8	8	8	1576	4	100	0.002	<LOD	N/A
Area	008	3 - northeast area of west wall at generator	10:49	14:06	197	8	8	8	1576	3	100	0.002	<LOD	N/A
Area	009	3 - southeast area of west wall at corner of 101 phase 3	10:51	14:08	197	8	8	8	1576	5.5	100	0.002	0.002	N/A
Area	010	3 southwest area of west wall at gate D	10:52	14:09	197	8	8	8	1576	6	100	0.002	0.002	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	08/23/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS

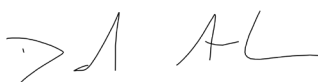
Project Name	776 Summer Street (Building 3 Phase 3 & West Wall Flashing Cement)(Power Plant)	Sample Date	08/24/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 3	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	3 - northwest area of west wall on summer street sidewalk	07:40	10:49	189	8	8	8	1512	4	100	0.002	<LOD	N/A
Area	004	3 southwest area of west wall at gate D	07:48	10:57	189	8	8	8	1512	6	100	0.002	0.002	N/A
Area	005	3 - southeast area of west wall at corner of 101 phase 3	07:50	10:54	184	8	8	8	1472	3.5	100	0.002	<LOD	N/A
Area	006	3 - northeast area of west wall at generator	07:52	11:00	188	8	8	8	1504	3.5	100	0.002	<LOD	N/A
Area	007	3 - northwest area of west wall on summer street sidewalk	10:49	13:47	178	8	8	8	1424	4	100	0.002	<LOD	N/A
Area	008	3 southwest area of west wall at gate D	10:57	13:53	176	8	8	8	1408	5.5	100	0.002	0.002	N/A
Area	009	3 - southeast area of west wall at corner of 101 phase 3	10:54	13:55	181	8	8	8	1448	3	100	0.002	<LOD	N/A
Area	010	3 - northeast area of west wall at generator	11:00	13:57	177	8	8	8	1416	4.5	100	0.002	0.002	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	08/24/2023
Analyst Signature			


Project Name	776 Summer St(Bldg 3 phase 3 & west wall flashing cement)(Power Plant)	Sample Date	08/25/2023
TRC Project #	474824	Sampling Technician	Adams, David
Client	Hilco	Laboratory	TRC
Facility Name	Building 3	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street Boston Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	3 - northwest area of west wall on summer street sidewalk	7:07	10:20	193	8	8	8	1544	3	100	0.002	<LOD	N/A
Area	004	3 southwest area of west wall at gate D	7:09	10:22	193	8	8	8	1544	2.5	100	0.002	<LOD	N/A
Area	005	3 - southeast area of west wall at corner of 101 phase 3	7:10	10:27	197	8	8	8	1576	1.5	100	0.002	<LOD	N/A
Area	006	3 - northeast area of west wall at generator	7:12	10:30	198	8	8	8	1584	2	100	0.002	<LOD	N/A
Area	007	3 - northwest area of west wall on summer street sidewalk	10:20	13:10	170	8	8	8	1360	4	100	0.002	<LOD	N/A
Area	008	3 southwest area of west wall at gate D	10:22	13:12	170	8	8	8	1360	2	100	0.002	<LOD	N/A
Area	009	3 - southeast area of west wall at corner of 101 phase 3	10:27	13:17	170	8	8	8	1356	3.5	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	010	3 - northeast area of west wall at generator	10:30	13:19	169	8	8	8	1352	3	100	0.002	<LOD	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	08/25/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (#11 Amendment)	Sample Date	08/29/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	11 - southeast area of steam drum containment across from amendment 10 debris pile	07:39	10:40	181	8	8	8	1448	7.5	100	0.002	0.003	N/A
Area	004	11 - southwest corner of metal / truck wash	07:40	10:41	181	8	8	8	1448	8	100	0.002	0.003	N/A
Area	005	11 - southeast area of steam drum containment across from amendment 10 debris pile	10:40	13:54	194	8	8	8	1552	6.5	100	0.002	0.002	N/A
Area	006	11 - southwest corner of metal / truck wash	10:41	13:55	194	8	8	8	1552	5.5	100	0.002	0.002	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	08/29/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (#11 Amendment)	Sample Date	08/30/2023
TRC Project #	474824	Sampling Technician	Jeremy Faulkner
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	North of Amendment 11 along turbine hall wall	07:44	10:45	181	8	8	8	1448	7	100	0.002	0.002	N/A
Area	004	NW of amendment 11 by truckwash	07:45	10:46	181	8	8	8	1448	6.5	100	0.002	0.002	N/A
Area	005	West of amendment 11 by dumpster	07:46	10:47	181	8	8	8	1448	5	100	0.002	0.002	N/A
Area	006	North of Amendment 11 along turbine hall wall	10:45	13:48	183	8	8	8	1464	5.5	100	0.002	0.002	N/A
Area	007	NW of amendment 11 by truckwash	10:46	13:49	183	8	8	8	1464	4	100	0.002	<LOD	N/A
Area	008	West of amendment 11 by dumpster	10:47	13:50	183	8	8	8	1464	3.5	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	Jeremy Faulkner	Analysis Date	08/30/2023
Analyst Signature			


Project Name	776 Summer Street (#11 Amendment)	Sample Date	08/31/2023
TRC Project #	474824	Sampling Technician	Jeremy Faulkner
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	North of Amendment 11 along turbine hall wall,	07:29	10:38	189	8	8	8	1512	5	100	0.002	0.002	N/A
Area	004	NW of amendment 11 by truckwash	07:30	10:39	189	8	8	8	1512	4.5	100	0.002	<LOD	N/A
Area	005	West of amendment 11 by dumpster	07:31	10:40	189	8	8	8	1512	8.5	100	0.002	0.003	N/A
Area	006	North of Amendment 11 along turbine hall wall,	10:38	13:47	189	8	8	8	1512	3	100	0.002	<LOD	N/A
Area	007	NW of amendment 11 by truckwash	10:39	13:50	191	8	8	8	1528	5.5	100	0.002	0.002	N/A
Area	008	West of amendment 11 by dumpster	10:40	13:49	189	8	8	8	1512	4	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	Jeremy Faulkner	Analysis Date	08/31/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (Phase 3 101)	Sample Date	08/28/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 3	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	3 - northwest area on summer Street sidewalk at gate C	07:35	10:35	180	8	8	8	1440	5.5	100	0.002	0.002	N/A
Area	004	3 southwest area of west wall at gate D	07:37	10:38	181	8	8	8	1448	4	100	0.002	<LOD	N/A
Area	005	3 - southeast area of building 3	07:42	10:42	180	8	8	8	1440	3	100	0.002	<LOD	N/A
Area	006	3 - northeast area at turbine hall 1 opening	07:44	10:44	180	8	8	8	1440	6	100	0.002	0.002	N/A
Area	007	3- northwest area on summer Street sidewalk at gate C	10:35	13:42	187	8	8	8	1496	6.5	100	0.002	0.002	N/A
Area	008	3 southwest area of west wall at gate D	10:37	13:44	187	8	8	8	1496	5	100	0.002	0.002	N/A
Area	009	3 - southeast area of building 3	10:42	13:49	187	8	8	8	1496	3.5	100	0.002	<LOD	N/A
Area	010	3 - northeast area at turbine hall 1 opening	10:44	13:51	187	8	8	8	1496	4.5	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	08/28/2023
Analyst Signature			


ASBESTOS AIR SAMPLE RESULTS

Project Name		776 Summer Street (Phase 3 101)					Sample Date		08/29/2023					
TRC Project #		474824					Sampling Technician		David Adams					
Client		HRP 776 Summer Street PropCo LLC					Laboratory		TRC					
Facility Name		Building 3					Sample/Analysis Method		NIOSH 7400					
Facility Location		776 Summer Street, Boston, Massachusetts					Sampling Type		PCM					
Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	3 - northwest area on summer Street sidewalk at gate C	07:33	10:35	182	8	8	8	1456	5.5	100	0.002	0.002	N/A
Area	004	3 southwest area of west wall at gate D	07:35	10:36	181	8	8	8	1448	7	100	0.002	0.002	N/A
Area	005	3 - southeast area of west wall at corner of 101 phase 3	07:40	10:41	181	8	8	8	1448	8	100	0.002	0.003	N/A
Area	006	3 - northeast area at turbine hall 1 opening	07:42	10:43	181	8	8	8	1448	4	10	0.019	<LOD	N/A
Area	007	3 - northwest area on summer Street sidewalk at gate C	10:35	13:48	193	8	8	8	1544	4.5	100	0.002	<LOD	N/A
Area	008	3 southwest area of west wall at gate D	10:36	13:50	194	8	8	8	1552	6	100	0.002	0.002	N/A
Area	009	3 - southeast area of west wall at corner of 101 phase 3	10:41	13:55	194	8	8	8	1552	5.5	100	0.002	0.002	N/A
Area	010	3 - northeast area at turbine hall 1 opening	10:43	13:57	194	8	8	8	1552	3	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	08/29/2023
Analyst Signature			


ASBESTOS AIR SAMPLE RESULTS

Project Name		776 Summer Street (Phase 3 101)					Sample Date		08/30/2023					
TRC Project #		474824					Sampling Technician		Jeremy Faulkner					
Client		HRP 776 Summer Street PropCo LLC					Laboratory		TRC					
Facility Name		Building 3					Sample/Analysis Method		NIOSH 7400					
Facility Location		776 Summer Street, Boston, Massachusetts					Sampling Type		PCM					
Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	3 - northwest area on summer Street sidewalk at gate C	07:27	10:36	189	8	8	8	1512	3	100	0.002	<LOD	N/A
Area	004	3 - southwest area of west wall at gate D,	07:29	10:37	188	8	8	8	1504	5	100	0.002	0.002	N/A
Area	005	3 - southeast area by hoppers next to Turbine hall (North of Amendment 11)	07:31	10:38	187	8	8	8	1496	7	100	0.002	0.002	N/A
Area	006	3 - northeast area at turbine hall 1 opening	07:33	10:39	186	8	8	8	1488	6.5	100	0.002	0.002	N/A
Area	007	3 - northwest area on summer Street sidewalk at gate C	10:36	13:54	198	8	8	8	1584	2.5	100	0.002	<LOD	N/A
Area	008	3 southwest area of west wall at gate D,	10:37	13:55	198	8	8	8	1584	4	100	0.002	<LOD	N/A
Area	009	3 - southeast area by hoppers next to Turbine hall (North of Amendment 11)	10:38	13:56	198	8	8	8	1584	5.5	100	0.002	0.002	N/A
Area	010	3 - northeast area at turbine hall 1 opening	10:39	13:57	198	8	8	8	1584	4	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	Jeremy Faulkner	Analysis Date	08/30/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (Phase 3 101)	Sample Date	08/31/2023
TRC Project #	474824	Sampling Technician	Jeremy Faulkner
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 3	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	3 - northwest area on summer Street sidewalk at gate C	07:40	10:50	190	8	8	8	1520	6	100	0.002	0.002	N/A
Area	004	3 - southwest area of west wall at gate D	07:41	10:51	190	8	8	8	1520	4	100	0.002	<LOD	N/A
Area	005	3 - southeast area by hoppers next to Turbine hall (North of Amendment 11)	07:43	10:52	189	8	8	8	1512	3	100	0.002	<LOD	N/A
Area	006	3 - northeast area at turbine hall 1 opening	07:44	10:53	189	8	8	8	1512	5.5	100	0.002	0.002	N/A
Area	007	3 - northwest area on summer Street sidewalk at gate C	10:50	13:49	179	8	8	8	1432	7	100	0.002	0.002	N/A
Area	008	3 - southwest area of west wall at gate D	10:51	13:50	179	8	8	8	1432	2.5	100	0.002	<LOD	N/A
Area	009	3 - southeast area by hoppers next to Turbine hall (North of Amendment 11)	10:52	13:51	179	8	8	8	1432	8	100	0.002	0.003	N/A
Area	010	3 - northeast area at turbine hall 1 opening	10:53	13:52	179	8	8	8	1432	4.5	100	0.002	0.002	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	Jeremy Faulkner	Analysis Date	08/31/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (#10 Amendment)	Sample Date	08/28/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	004	4 - Beginning of brick wall at sidewalk and generator	07:40	10:40	180	8	8	8	1440	6	100	0.002	0.002	N/A
Background	005	4 - southeast area of containment across from debris pile (amendment 10)	07:41	10:41	180	8	8	8	1440	3.5	100	0.002	<LOD	N/A
Background	006	4 east area between amendment 10 & 11	07:42	10:42	180	8	8	8	1440	4	100	0.002	<LOD	N/A
Area	007	4 - south area at wall knockout	10:39	13:46	187	8	8	8	1496	5	100	0.002	0.002	N/A
Background	008	4 - Beginning of brick wall at sidewalk and generator	10:40	13:47	187	8	8	8	1496	4.5	100	0.002	<LOD	N/A
Background	009	4 - southeast area of containment across from debris pile (amendment 10)	10:41	13:48	187	8	8	8	1496	3	100	0.002	<LOD	N/A
Background	010	4 east area between amendment 10 & 11	10:42	13:49	187	8	8	8	1496	3.5	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	08/28/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (#10 Amendment)	Sample Date	08/29/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	4 - south area at wall knockout	07:37	10:38	181	8	8	8	1448	3.5	100	0.002	<LOD	N/A
Area	004	4 - Beginning of brick wall at sidewalk and generator	07:38	10:39	181	8	8	8	1448	4	100	0.002	<LOD	N/A
Area	005	4 - southeast area of containment across from debris pile (amendment 10)	07:39	10:40	181	8	8	8	1448	7.5	100	0.002	0.003	N/A
Area	006	4 east area between amendment 10 & 11	07:40	10:41	181	8	8	8	1448	8	100	0.002	0.003	N/A
Area	007	4 - south area at wall knockout	10:38	13:52	194	8	8	8	1552	5	100	0.002	0.002	N/A
Area	008	4 - Beginning of brick wall at sidewalk and generator	10:39	13:53	194	8	8	8	1552	4.5	100	0.002	<LOD	N/A
Area	009	4 - southeast area of containment across from debris pile (amendment 10)	10:40	13:54	194	8	8	8	1552	6.5	100	0.002	0.002	N/A
Area	010	4 east area between amendment 10 & 11	10:41	13:55	194	8	8	8	1552	5.5	100	0.002	0.002	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	08/29/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (#10 Amendment)	Sample Date	08/30/2023
TRC Project #	474824	Sampling Technician	Jeremy Faulkner
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	4 - south area at wall knockout	07:32	10:48	196	8	8	8	1568	3	100	0.002	<LOD	N/A
Background	004	4 - Beginning of brick wall at sidewalk and generator	07:34	10:50	196	8	8	8	1568	2	100	0.002	<LOD	N/A
Background	005	4 - southeast area of containment across from amendment 10	07:36	10:52	196	8	8	8	1568	4.5	100	0.002	<LOD	N/A
Background	006	4 - east area between amendment 10 & 11	07:38	10:54	196	8	8	8	1568	5	100	0.002	0.002	N/A
Background	007	4 - south area at wall knockout	10:48	13:51	183	8	8	8	1464	3.5	100	0.002	<LOD	N/A
Background	008	4 - Beginning of brick wall at sidewalk and generator	10:50	13:53	183	8	8	8	1464	6	100	0.002	0.002	N/A
Background	009	4 - southeast area of containment across from amendment 10	10:52	13:55	183	8	8	8	1464	7.5	100	0.002	0.003	N/A
Background	010	4 - east area between amendment 10 & 11	10:54	13:57	183	8	8	8	1464	3.5	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	Jeremy Faulkner	Analysis Date	08/30/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS

Project Name	776 Summer Street (#10 Amendment)	Sample Date	08/31/2023
TRC Project #	474824	Sampling Technician	Jeremy Faulkner
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	4 - south area at wall knockout	07:32	10:43	191	8	8	8	1528	3	100	0.002	<LOD	N/A
Area	004	4 - Beginning of brick wall at sidewalk and generator	07:33	10:44	191	8	8	8	1528	2	100	0.002	<LOD	N/A
Area	005	4 - southeast area of containment across from amendment 10	07:34	10:45	191	8	8	8	1528	5	100	0.002	0.002	N/A
Area	006	4 - east area between amendment 10 & 11	07:35	10:46	191	8	8	8	1528	4.5	100	0.002	<LOD	N/A
Area	007	4 - south area at wall knockout	10:43	13:44	181	8	8	8	1448	6	100	0.002	0.002	N/A
Area	008	4 - Beginning of brick wall at sidewalk and generator	10:44	13:45	181	8	8	8	1448	4	100	0.002	<LOD	N/A
Area	009	4 - southeast area of containment across from amendment 10	10:45	13:46	181	8	8	8	1448	6.5	100	0.002	0.002	N/A
Area	010	4 - east area between amendment 10 & 11	10:46	13:47	181	8	8	8	1448	3	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	Jeremy Faulkner	Analysis Date	08/31/2023
Analyst Signature	