



2 Liberty Sq., 6th Floor
Boston, MA 02109

T 617.350.3444
TRCcompanies.com

Asbestos Abatement Air Sampling Report

L Street Station Project

Boston, Massachusetts

Prepared for HRP 776 Summer Street, LLC
October 2023

ASBESTOS ABATEMENT AIR SAMPLING REPORT

L STREET STATION PROJECT

October 2023

1.0 INTRODUCTION

TRC Environmental, Inc. (TRC) has prepared this Air Sampling Report on behalf of HRP 776 Summer Street, LLC (the Client) for the deconstruction phase of the L Street Station project at 776 Summer Street in Boston, Massachusetts (the Site).

The air sampling is as described and in accordance with the requirements of the Non-Traditional Work Plan (NTWP) in place for the project, as approved by MassDEP (NTWP Approval NNT-220007). Pursuant to the NTWP, on a daily basis, TRC provides air sampling during asbestos abatement around the perimeter of the asbestos removal work areas, and as required for final air clearance at the completion of asbestos removal in contained work areas. Sample results are emailed to MassDEP at the end of the shift.

The air samples are analyzed by TRC's Asbestos Project Monitor after collection, typically twice per shift, in accordance with the Phase Contrast Microscopy (PCM) method. The results for each sample are then recorded in fibers per cubic centimeter of air (f/cc) on the air sampling data sheet. These air sample results and data sheets are attached to this report.



This report provides the air sampling results collected at the Site from the beginning of the abatement monitoring on October 2, through 31, 2023. Pursuant to the NTWP approved by DEP, the air sampling action level is < 0.010 f/cc. All air sample collected at the containment perimeter barriers, by TRC in connection with this work have been less than 0.010 f/cc throughout this time period.

2.0 DESCRIPTION OF SITE CONDITIONS

The Site previously operated as an electrical power plant. With the exception of one building, referred to as the Administration Office Building, the Site is vacant.

The Site is located in an urban area of South Boston and is bounded on all sides by roads.

3.0 AIR SAMPLING ACTION LEVELS

The action level required for this project for PCM air samples during abatement, as established in the NTWP, is less than 0.010 f/cc. If this level is reached or exceeded, asbestos abatement work is stopped, the MassDEP notified, and appropriate corrective measures taken. The level of 0.010 f/cc is also used for air clearance following abatement, to "clear" space for use prior to disassembling containment. On occasion, typically for "clearing" a large work area where PCM air sampling may be impractical, the Transmission Electron Microscopy (TEM) method will be used, which has a clearance level of an average of less than 70 structures per square millimeter (s/mm). TEM results, if any, associated with clearing work areas will be included in this report.

4.0 AIR SAMPLING

Pursuant to the approved NTWP, all area air samples are collected using the same basic techniques. The air sampling pumps are calibrated using a primary or secondary standard. The sample cassette is set between 4 to 5 feet above the floor/ground and angled downward at a 45-degree angle. Samples are collected "open faced," meaning that the cap at the inlet end of the extension has been removed so the entire surface of the



filter is exposed to the air. Samples are typically collected over a 2-to-3-hour period. Pumps are post-calibrated and the before and after flow rates are averaged. Chain-Of-Custody forms are completed, and the samples are analyzed.

Air samples are usually grouped together for each work area, as per the NTWP. Some results are recorded as <LOD, meaning that the result for that sample is below the limit of detection for the method (typically less than 0.002 f/cc, which is well below the action level).

5.0 CORRECTIVE MEASURES

No corrective measures were required October 2, through October 31, 2023, because all air sample results were below the action level.

ATTACHMENTS

Air sample results


Project Name	776 Summer Street (Background Sampling)(Power Plant)	Sample Date	10/02/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	4 - Gate D	07:23	10:31	188	8	8	8	1504	6	100	0.002	0.002	N/A
Background	004	4 - Beginning of brick wall at Summer Street sidewalk	07:24	10:32	188	8	8	8	1504	4.5	100	0.002	<LOD	N/A
Background	005	4 - wall knockout at bus stop	07:25	10:33	188	8	8	8	1504	4.5	100	0.002	<LOD	N/A
Background	006	4 - Gate D	10:31	13:45	194	8	8	8	1552	4	100	0.002	<LOD	N/A
Background	007	4 - Beginning of brick wall at Summer Street sidewalk	10:32	13:46	194	8	8	8	1552	3	100	0.002	<LOD	N/A
Background	008	4 - wall knockout at bus stop	10:33	13:47	194	8	8	8	1552	5.5	100	0.002	0.002	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	10/02/2023
Analyst Signature			


Project Name	776 Summer Street (Background Sampling)(Power Plant)	Sample Date	10/03/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	4 - Gate D	07:20	10:43	203	8	8	8	1624	7	100	0.002	0.002	N/A
Background	004	4 - Beginning of brick wall at Summer Street sidewalk	07:21	10:44	203	8	8	8	1624	3	100	0.002	<LOD	N/A
Background	005	4 - wall knockout at bus stop	07:22	10:45	203	8	8	8	1624	2.5	100	0.002	<LOD	N/A
Background	006	4 - Gate D	10:43	13:46	183	8	8	8	1464	5.5	100	0.002	0.002	N/A
Background	007	4 - Beginning of brick wall at Summer Street sidewalk	10:44	13:47	183	8	8	8	1464	3.5	100	0.002	<LOD	N/A
Background	008	4 - wall knockout at bus stop	10:45	13:48	183	8	8	8	1464	6	100	0.002	0.002	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	10/03/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (Background Sampling)(Power Plant)	Sample Date	10/04/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	4 - Gate D	07:15	10:40	205	8	8	8	1640	4	100	0.002	<LOD	N/A
Area	004	4 - Beginning of brick wall at Summer Street sidewalk	07:16	10:41	205	8	8	8	1640	7	100	0.002	0.002	N/A
Area	005	4 - wall knockout at bus stop	07:17	10:42	205	8	8	8	1640	4.5	100	0.002	<LOD	N/A
Background	006	4 - Gate D	10:40	13:55	195	8	8	8	1560	4.5	100	0.002	<LOD	N/A
Background	007	4 - Beginning of brick wall at Summer Street sidewalk	10:41	13:55	194	8	8	8	1552	5.5	100	0.002	0.002	N/A
Background	008	4 - wall knockout at bus stop	10:42	13:57	195	8	8	8	1560	3	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	10/04/2023
Analyst Signature			


Project Name	776 Summer Street (Background Sampling)(Power Plant)	Sample Date	10/05/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	4 - Gate D	07:25	10:33	188	8	8	8	1504	5.5	100	0.002	0.002	N/A
Background	004	4 - Beginning of brick wall at Summer Street sidewalk	07:26	10:34	188	8	8	8	1504	7	100	0.002	0.002	N/A
Background	005	4 - wall knockout at bus stop	07:27	10:35	188	8	8	8	1504	4	100	0.002	<LOD	N/A
Background	006	4 - Gate D	10:33	13:40	187	8	8	8	1496	5	100	0.002	0.002	N/A
Background	007	4 - Beginning of brick wall at Summer Street sidewalk	10:34	13:41	187	8	8	8	1496	7.5	100	0.002	0.002	N/A
Background	008	4 - wall knockout at bus stop	10:35	13:42	187	8	8	8	1496	5.5	100	0.002	0.002	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

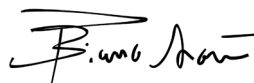
Analysis Information

Analyst	David Adams	Analysis Date	10/05/2023
Analyst Signature			

Project Name	776 Summer Street (Background Sampling)(Power Plant)	Sample Date	10/06/2023
TRC Project #	474824	Sampling Technician	Diana Carolina Saune Barrientos
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	4-Gate D	06:35	10:45	250	8	8	8	2000	4.5	100	0.001	0.001	N/A
Background	004	4-beginning of break wall at summer st	06:40	10:40	240	8	8	8	1920	6	100	0.001	0.002	N/A
Background	005	4-wall knockout at bus stop	06:50	10:50	240	8	8	8	1920	5.5	100	0.001	0.001	N/A
Background	006	4-Gate D	10:47	14:00	193	8	8	8	1544	3.5	100	0.002	<LOD	N/A
Background	007	4-beginning of break wall at summer st	10:42	14:05	203	8	8	8	1624	5	100	0.002	0.002	N/A
Background	008	4-wall knockout at bus stop	10:52	14:10	198	8	8	8	1584	4	100	0.002	<LOD	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	Diana Carolina Saune Barrientos	Analysis Date	10/06/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (#7 Amendment)(Power Plant)	Sample Date	10/03/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	7 - east wall adjacent to stairway	10:33	12:15	102	12	12	12	1224	2.5	100	0.002	<LOD	N/A
Area	004	7 - southeast area of South wall	10:34	12:16	102	12	12	12	1224	4	100	0.002	0.002	N/A
Area	005	7 - southwest area of South wall	10:35	12:17	102	12	12	12	1224	4.5	100	0.002	0.002	N/A
Area	006	7 - west wall	10:36	12:18	102	12	12	12	1224	3	100	0.002	<LOD	N/A
Area	007	7 - east wall adjacent to stairway	12:15	13:57	102	12	12	12	1224	3	100	0.002	<LOD	N/A
Area	008	7 - southeast area of South wall	12:16	13:58	102	12	12	12	1224	2.5	100	0.002	<LOD	N/A
Area	009	7 - southwest area of South wall	12:17	13:59	102	12	12	12	1224	3.5	100	0.002	<LOD	N/A
Area	010	7 - west wall	12:18	14:00	102	12	12	12	1224	6	100	0.002	0.002	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	10/03/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (#7 Amendment)(Power Plant)	Sample Date	10/04/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	7 - east wall adjacent to stairway	07:45	10:55	190	8	8	8	1520	3.5	100	0.002	<LOD	N/A
Area	004	7 - southeast area of South wall	07:46	10:56	190	8	8	8	1520	8.5	100	0.002	0.003	N/A
Area	005	7 - southwest area of South wall	07:47	10:57	190	8	8	8	1520	6.5	100	0.002	0.002	N/A
Area	006	7 - west wall	07:48	10:58	190	8	8	8	1520	4	100	0.002	<LOD	N/A
Area	007	7 - east wall adjacent to stairway	10:55	14:11	196	8	8	8	1568	3	100	0.002	<LOD	N/A
Area	008	7 - southeast area of South wall	10:56	14:12	196	8	8	8	1568	7	100	0.002	0.002	N/A
Area	009	7 - southwest area of South wall	10:57	14:13	196	8	8	8	1568	4.5	100	0.002	<LOD	N/A
Area	010	7 - west wall	10:58	14:14	196	8	8	8	1568	3.5	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	10/04/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS

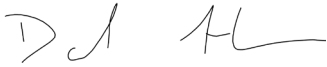
Project Name	776 Summer Street (#7 Amendment)(Power Plant)	Sample Date	10/05/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	7 - east wall adjacent to stairway	07:39	10:45	186	8	8	8	1488	4	100	0.002	<LOD	N/A
Area	004	7 - southeast area of South wall	07:40	10:46	186	8	8	8	1488	5.5	100	0.002	0.002	N/A
Area	005	7 - southwest area of South wall	07:41	10:47	186	8	8	8	1488	3.5	100	0.002	<LOD	N/A
Area	006	7 - west wall	07:42	10:48	186	8	8	8	1488	3.5	100	0.002	<LOD	N/A
Area	007	7 - east wall adjacent to stairway	10:45	13:30	165	8	8	8	1320	6.5	100	0.002	0.002	N/A
Area	008	7 - southeast area of South wall	10:46	13:31	165	8	8	8	1320	4	100	0.002	<LOD	N/A
Area	009	7 - southwest area of South wall	10:47	13:32	165	8	8	8	1320	5.5	100	0.002	0.002	N/A
Area	010	7 - west wall	10:48	13:33	165	8	8	8	1320	4.5	100	0.002	0.002	N/A
Background	011	7 - east wall adjacent to stairway	13:30	16:15	165	8	8	8	1320	5	100	0.002	0.002	N/A
Area	012	7 - southeast area of South wall	13:31	16:16	165	8	8	8	1320	7.5	100	0.002	0.003	N/A
Area	013	7 - southwest area of South wall	13:32	16:17	165	8	8	8	1320	4	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	014	7 - west wall	13:33	16:18	165	8	8	8	1320	6	100	0.002	0.002	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	10/05/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (#7 Amendment)(Power Plant)	Sample Date	10/06/2023
TRC Project #	474824	Sampling Technician	Diana Carolina Saune Barrientos
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	7-East wall adjacent to stairway	07:00	11:58	298	8	8	8	2384	5.5	100	0.001	0.001	N/A
Area	004	7-southeast area of south wall	07:05	11:05	240	8	8	8	1920	6	100	0.001	0.002	N/A
Area	005	7-southwest area of south wall	19:10	11:10	960	8	8	8	7680	4	100	0	0	N/A
Area	006	7-west wall	07:20	11:20	240	8	8	8	1920	7	100	0.001	0.002	N/A
Area	007	7-East wall adjacent to stairway	11:02	13:40	158	8	8	8	1264	4	100	0.002	0.002	N/A
Area	008	7-southeast area of south wall	11:07	13:45	158	8	8	8	1264	4	100	0.002	0.002	N/A
Area	009	7-southwest area of south wall	11:12	13:55	163	8	8	8	1304	5.5	100	0.002	0.002	N/A
Area	010	7-west wall	11:22	14:00	158	8	8	8	1264	6	100	0.002	0.002	N/A
Area	011	7-East wall adjacent to stairway	13:42	15:30	108	8	8	8	864	4.5	100	0.003	0.003	N/A
Area	012	7-southeast area of south wall	13:47	15:35	108	8	8	8	864	5	100	0.003	0.003	N/A
Area	013	7-southwest area of south wall	13:57	15:40	103	8	8	8	824	3	100	0.003	<LOD	N/A
Area	014	7-west wall	14:02	16:00	118	8	8	8	944	4.5	100	0.003	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	Diana Carolina Saune Barrientos	Analysis Date	10/06/2023
Analyst Signature			

Project Name	776 Summer Street (#7 Amendment)(Power Plant)	Sample Date	10/10/2023
TRC Project #	474824	Sampling Technician	Diana Carolina Saune Barrientos
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, MA	Sampling Type	PCM


Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	7-East wall adjacent to stairwell	07:00	10:58	238	8	8	8	1904	6.5	100	0.001	0.002	N/A
Area	004	7-Southeast area of south wall	07:05	11:05	240	8	8	8	1920	6	100	0.001	0.002	N/A
Area	005	7-Southwest area of south wall	07:10	11:10	240	8	8	8	1920	4	100	0.001	0.001	N/A
Area	006	7-West wall	07:15	11:15	240	8	8	8	1920	7.5	100	0.001	0.002	N/A
Area	007	7-East wall adjacent to stairwell	11:02	13:40	158	8	8	8	1264	8	100	0.002	0.003	N/A
Area	008	7-Southeast area of south wall	11:07	13:45	158	8	8	8	1264	6.5	100	0.002	0.003	N/A
Area	009	7-Southwest area of south wall	11:12	13:55	163	8	8	8	1304	6	100	0.002	0.002	N/A
Area	010	7-West wall	11:22	14:00	158	8	8	8	1264	8	100	0.002	0.003	N/A
Area	011	7-East wall adjacent to stairwell	13:42	15:30	108	8	8	8	864	7.5	100	0.003	0.004	N/A
Area	012	7-Southeast area of south wall	13:47	15:35	108	8	8	8	864	5.5	100	0.003	0.003	N/A
Area	013	7-Southwest area of south wall	13:57	15:46	109	8	8	8	872	4.5	100	0.003	0.003	N/A
Area	014	7-West wall	14:02	16:00	118	8	8	8	944	5	100	0.003	0.003	N/A

ASBESTOS AIR SAMPLE RESULTS

Project Name	776 Summer Street (Background Sampling) (Power Plant)	Sample Date	10/10/2023
TRC Project #	474824	Sampling Technician	Diana Carolina Saune Barrientos
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, MA	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	Gate D	06:35	10:30	235	8	8	8	1880	5	100	0.001	0.001	N/A
Background	004	Beginning of break wall at summer st	06:40	10:35	235	8	8	8	1880	4.5	100	0.001	0.001	N/A
Background	005	Wall knockout at bus stop	06:50	10:40	230	8	8	8	1840	5	100	0.001	0.001	N/A
Background	006	Gate D	10:32	13:30	178	8	8	8	1424	4	100	0.002	<LOD	N/A
Background	007	Beginning of break wall at summer st	10:37	13:35	178	8	8	8	1424	6.5	100	0.002	0.002	N/A
Background	008	Wall knockout at bus stop	10:42	13:40	178	8	8	8	1424	6	100	0.002	0.002	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	Diana Carolina	Analysis Date	10/10/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (Background Sampling) (Power Plant)	Sample Date	10/11/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, MA	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	4 - Gate D	07:23	10:35	192	8	8	8	1536	6	100	0.002	0.002	N/A
Background	004	4 - Beginning of brick wall at Summer Street sidewalk	07:24	10:29	185	8	8	8	1480	4.5	100	0.002	<LOD	N/A
Background	005	4 - wall knockout at bus stop	07:25	10:30	185	8	8	8	1480	2	100	0.002	<LOD	N/A
Background	006	4 - Gate D	10:28	13:40	192	8	8	8	1536	3.5	100	0.002	<LOD	N/A
Background	007	4 - Beginning of brick wall at Summer Street sidewalk	10:29	13:41	192	8	8	8	1536	5	100	0.002	0.002	N/A
Background	008	4 - wall knockout at bus stop	10:30	13:42	192	8	8	8	1536	2.5	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	10/11/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (Background Sampling) (Power Plant)	Sample Date	10/12/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, MA	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	4 - Gate D	07:23	10:40	197	8	8	8	1576	4	100	0.002	<LOD	N/A
Background	004	4 - Beginning of brick wall at Summer Street sidewalk	07:24	10:41	197	8	8	8	1576	6.5	100	0.002	0.002	N/A
Background	005	4 - wall knockout at bus stop	07:25	10:42	197	8	8	8	1576	4.5	109	0.002	<LOD	N/A
Background	006	4 - Gate D	10:40	14:11	211	8	8	8	1688	3	100	0.002	<LOD	N/A
Background	007	4 - Beginning of brick wall at Summer Street sidewalk	10:41	14:12	211	8	8	8	1688	4	100	0.002	<LOD	N/A
Background	008	4 - wall knockout at bus stop	10:42	14:13	211	8	8	8	1688	2.5	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	10/12/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (Background Sampling) (Power Plant)	Sample Date	10/13/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, MA	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	4 - Gate D	07:23	10:28	185	8	8	8	1480	6	100	0.002	0.002	N/A
Background	004	4 - Beginning of brick wall at Summer Street sidewalk	07:24	10:29	185	8	8	8	1480	4.5	100	0.002	<LOD	N/A
Background	005	4 - wall knockout at bus stop	07:25	10:30	185	8	8	8	1480	2	100	0.002	<LOD	N/A
Background	006	4 - Gate D	10:28	13:40	192	8	8	8	1536	3.5	100	0.002	<LOD	N/A
Background	007	4 - Beginning of brick wall at Summer Street sidewalk	10:29	13:41	192	8	8	8	1536	5	100	0.002	0.002	N/A
Background	008	4 - wall knockout at bus stop	10:30	13:42	192	8	8	8	1536	3.5	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

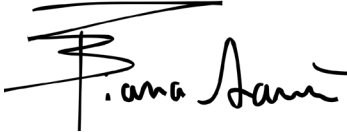
Analysis Information

Analyst	David Adams	Analysis Date	10/13/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	Diana Carolina Saune Barrientos	Analysis Date	10/10/2023
Analyst Signature			


Project Name	776 Summer Street (Background Sampling)(Power Plant)	Sample Date	10/16/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	4 - Gate D	07:20	10:35	195	8	8	8	1560	3.5	100	0.002	<LOD	N/A
Background	004	4 - Beginning of brick wall at Summer Street sidewalk	07:21	10:36	195	8	8	8	1560	6	100	0.002	0.002	N/A
Background	005	4 - wall knockout at bus stop	07:22	10:37	195	8	8	8	1560	3	100	0.002	<LOD	N/A
Background	006	4 - Gate D	10:35	13:47	192	8	8	8	1536	4.5	100	0.002	<LOD	N/A
Area	007	4 - Beginning of brick wall at Summer Street sidewalk	10:36	13:48	192	8	8	8	1536	5.5	100	0.002	0.002	N/A
Background	008	4 - wall knockout at bus stop	10:37	13:49	192	8	8	8	1536	3.5	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A


Analysis Information

Analyst	David Adams	Analysis Date	10/16/2023
Analyst Signature			

Project Name	776 Summer Street (Background Sampling) (Power Plant)	Sample Date	10/17/2023
TRC Project #	474824	Sampling Technician	Jeremy Faulkner
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Suffolk County, MA 02127 US	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	Gate D	07:24	10:31	187	8	8	8	1496	3	100	0.002	<LOD	N/A
Background	004	Beginning of break wall at summer st	07:25	10:32	187	8	8	8	1496	4.5	100	0.002	<LOD	N/A
Background	005	Wall knockout at bus stop	07:26	10:33	187	8	8	8	1496	7	100	0.002	0.002	N/A
Background	006	Gate D	10:31	13:46	195	8	8	8	1560	4	100	0.002	<LOD	N/A
Background	007	Beginning of break wall at summer st	10:32	13:47	195	8	8	8	1560	5.5	100	0.002	0.002	N/A
Background	008	Wall knockout at bus stop	10:33	13:48	195	8	8	8	1560	6	100	0.002	0.002	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	Jeremy Faulkner	Analysis Date	10/17/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS

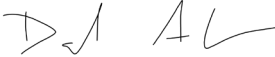
Project Name	776 Summer Street (#7 Amendment)(Power Plant)	Sample Date	10/18/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	7 - east wall adjacent to stairway - level 13	09:15	11:45	150	8	8	8	1200	3	100	0.002	<LOD	N/A
Area	004	7 - southeast area of South wall - level 13	09:16	11:46	150	8	8	8	1200	4	100	0.002	0.002	N/A
Area	005	7 - southwest area of South wall - level 13	09:17	11:47	150	8	8	8	1200	3.5	100	0.002	<LOD	N/A
Area	006	7 - west wall level 13	09:18	11:48	150	8	8	8	1200	2	100	0.002	<LOD	N/A
Area	007	7 - east wall adjacent to stairway - level 13	11:45	14:17	152	8	8	8	1216	2.5	100	0.002	<LOD	N/A
Area	008	7 - southeast area of South wall - level 13	11:46	14:18	152	8	8	8	1216	3	100	0.002	<LOD	N/A
Area	009	7 - southwest area of South wall - level 13	11:47	14:18	151	8	8	8	1208	5	100	0.002	0.002	N/A
Area	010	7 - west wall level 13	11:48	14:20	152	8	8	8	1216	2.5	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	10/18/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (#7 Amendment)(Power Plant)	Sample Date	10/19/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	7 - east wall adjacent to stairway - level 13	08:15	10:51	156	8	8	8	1248	3.5	100	0.002	<LOD	N/A
Area	004	7 - southeast area of South wall - level 13	08:16	10:52	156	8	8	8	1248	2	100	0.002	<LOD	N/A
Area	005	7 - southwest area of South wall - level 13	08:17	10:53	156	8	8	8	1248	5.5	100	0.002	0.002	N/A
Area	006	7 - west wall level 13	08:18	10:54	156	8	8	8	1248	4	100	0.002	0.002	N/A
Area	007	7 - east wall adjacent to stairway - level 13	10:51	14:18	207	8	8	8	1656	2.5	100	0.002	<LOD	N/A
Area	008	7 - southeast area of South wall - level 13	10:52	14:19	207	8	8	8	1656	2	100	0.002	<LOD	N/A
Area	009	7 - southwest area of South wall - level 13	10:53	14:20	207	8	8	8	1656	5	100	0.002	<LOD	N/A
Area	010	7 - west wall level 13	10:54	14:21	207	8	8	8	1656	5.5	100	0.002	0.002	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	10/19/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (#3 Amendment - South Wall)(Power Plant)	Sample Date	10/18/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 3 Footprint	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	3 - southwest area at HEPA exhaust	09:01	11:34	153	8	8	8	1224	3	100	0.002	<LOD	N/A
Area	004	3 - southeast area of containment	09:02	11:35	153	8	8	8	1224	2.5	100	0.002	<LOD	N/A
Area	005	3 - northeast area at decon	09:03	11:36	153	8	8	8	1224	4	100	0.002	0.002	N/A
Area	006	3 - northwest area of containment	09:04	11:37	153	8	8	8	1224	2.5	100	0.002	<LOD	N/A
Area	007	3 - southwest area at HEPA exhaust	11:34	14:05	151	8	8	8	1208	4.5	100	0.002	0.002	N/A
Area	008	3 - southeast area of containment	11:35	14:06	151	8	8	8	1208	3	100	0.002	<LOD	N/A
Area	009	3 - northeast area at decon	11:36	14:07	151	8	8	8	1208	5	100	0.002	0.002	N/A
Area	010	3 - northwest area of containment	11:37	14:08	151	8	8	8	1208	2.5	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A


Analysis Information

Analyst	David Adams	Analysis Date	10/18/2023
Analyst Signature			

Project Name	776 Summer Street (#3 Amendment - South Wall)(Power Plant)	Sample Date	10/19/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 3 Footprint	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Clearance	003	West area inside containment adjacent HEPA unit	08:03	09:45	102	12	12	12	1224	4	100	0.002	0.002	N/A
Clearance	004	East area inside containment	08:04	09:46	102	12	12	12	1224	2.5	100	0.002	<LOD	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	10/19/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (#3 Amendment - Southwest Corner Mastic)(Power Plant)	Sample Date	10/20/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 3	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	Northeast area neat decon	07:40	10:45	185	8	8	8	1480	5	100	0.002	0.002	N/A
Area	004	Southeast area at hepa exhaust	07:41	10:46	185	8	8	8	1480	4	100	0.002	<LOD	N/A
Area	005	Southwest area at gate D	07:42	10:47	185	8	8	8	1480	3.5	100	0.002	<LOD	N/A
Area	006	Northwest area at sidewalk	07:43	10:48	185	8	8	8	1480	6	100	0.002	0.002	N/A
Clearance	007	East area inside containment adjacent hepa unit	11:50	13:35	105	12	12	12	1260	1.5	100	0.002	<LOD	N/A
Clearance	008	West area inside containment adjacent decon	11:51	13:36	105	12	12	12	1260	2	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	10/20/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (#3 Amendment Area 2)(Power Plant)	Sample Date	10/27/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 3	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	3 - northwest area of containment on sidewalk	07:35	10:30	175	8	8	8	1400	6	100	0.002	0.002	N/A
Area	004	3 - southwest area of containment on sidewalk	07:36	10:31	175	8	8	8	1400	4.5	100	0.002	0.002	N/A
Area	005	3 - southeast area of containment at decon	07:37	10:32	175	8	8	8	1400	4	100	0.002	<LOD	N/A
Area	006	3 - northeast area of containment at hepa exhaust	10:33	13:38	185	8	8	8	1480	3	100	0.002	<LOD	N/A
Area	007	3 - northwest area of containment on sidewalk	10:30	13:35	185	8	8	8	1480	4	100	0.002	<LOD	N/A
Area	008	3 - southwest area of containment on sidewalk	10:31	13:36	185	8	8	8	1480	4.5	100	0.002	<LOD	N/A
Area	009	3 - southeast area of containment at decon	10:32	13:37	185	8	8	8	1480	3.5	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	010	3 - northeast area of containment at hepa exhaust	10:33	13:38	185	8	8	8	1480	3	100	0.002	<LOD	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information


Analyst	David Adams	Analysis Date	10/27/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS

Project Name	776 Summer Street (#3 Amendment, Caulking Area 1)(Power Plant)	Sample Date	10/25/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 3	Sample/Analysis Method	NIOSH 7400
Facility Location	766 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	Northwest area on sidewalk	12:05	14:06	121	10	10	10	1210	4.5	100	0.002	0.002	N/A
Area	004	Southwest area on sidewalk	12:06	14:07	121	10	10	10	1210	3.5	100	0.002	<LOD	N/A
Area	005	Southeast area at decon	12:07	14:08	121	10	10	10	1210	6	100	0.002	0.002	N/A
Area	006	Northeast area at HEPA exhaust	12:08	14:09	121	10	10	10	1210	4	100	0.002	0.002	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information


Analyst	David Adams	Analysis Date	10/25/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS

Project Name	776 Summer Street (#3 Amendment, Caulking Area 1)(Power Plant)	Sample Date	10/26/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 3	Sample/Analysis Method	NIOSH 7400
Facility Location	766 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Clearance	003	North area inside containment	08:15	10:00	105	12	12	12	1260	2	100	0.002	<LOD	N/A
Clearance	004	South area inside containment	08:16	10:01	105	12	12	12	1260	1	100	0.002	<LOD	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	10/26/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (#7 Amendment Level 13 East)(Power Plant)	Sample Date	10/23/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	7 - east wall adjacent to stairway - level 13	07:40	10:55	195	8	8	8	1560	3	100	0.002	<LOD	N/A
Area	004	7 - southeast area of South wall - level 13	07:41	10:56	195	8	8	8	1560	6	100	0.002	0.002	N/A
Area	005	7 - southwest area of South wall - level 13	07:42	10:57	195	8	8	8	1560	4.5	100	0.002	<LOD	N/A
Area	006	7 - west wall level 13	07:43	10:58	195	8	8	8	1560	2.5	100	0.002	<LOD	N/A
Area	007	7 - east wall adjacent to stairway - level 13	10:55	13:57	182	8	8	8	1456	4.5	100	0.002	0.002	N/A
Area	008	7 - southeast area of South wall - level 13	10:56	13:58	182	8	8	8	1456	5.5	100	0.002	0.002	N/A
Area	009	7 - southwest area of South wall - level 13	10:57	13:59	182	8	8	8	1456	3.5	100	0.002	<LOD	N/A
Area	010	7 - west wall level 13	10:58	14:00	182	8	8	8	1456	3	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	10/23/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (#7 Amendment Level 13 East)(Power Plant)	Sample Date	10/24/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	7 - northeast wall - level 13	07:30	10:40	190	8	8	8	1520	6	100	0.002	0.002	N/A
Area	004	7 - southeast corner area - level 13	07:31	10:41	190	8	8	8	1520	4.5	100	0.002	<LOD	N/A
Area	005	7 - center of Southeast area wall - level 13	07:32	10:42	190	8	8	8	1520	3	100	0.002	<LOD	N/A
Area	006	7 - Center stairwell area - level 13	07:33	10:43	190	8	8	8	1520	3	100	0.002	<LOD	N/A
Area	007	7 - northeast wall - level 13	10:40	13:45	185	8	8	8	1480	5.5	100	0.002	0.002	N/A
Area	008	7 - southeast corner area - level 13	10:41	13:46	185	8	8	8	1480	5	100	0.002	0.002	N/A
Area	009	7 - center of Southeast area wall - level 13	10:42	13:47	185	8	8	8	1480	6.5	100	0.002	0.002	N/A
Area	010	7 - Center stairwell area - level 13	10:43	13:48	185	8	8	8	1480	4	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	10/24/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (#7 Amendment Level 13 East)(Power Plant)	Sample Date	10/25/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	7 - northeast wall - level 13	07:38	11:00	202	8	8	8	1616	4.5	100	0.002	<LOD	N/A
Area	004	7 - southeast corner area - level 13	07:39	11:01	202	8	8	8	1616	3	100	0.002	<LOD	N/A
Area	005	7 - center of Southeast area wall - level 13	07:40	11:02	202	8	8	8	1616	3.5	100	0.002	<LOD	N/A
Area	006	7 - Center stairwell area - level 13	07:41	11:03	202	8	8	8	1616	5.5	100	0.002	0.002	N/A
Area	007	7 - northeast wall - level 13	11:00	13:55	175	8	8	8	1400	5.5	100	0.002	0.002	N/A
Area	008	7 - southeast corner area - level 13	11:01	13:56	175	8	8	8	1400	7	100	0.002	0.002	N/A
Area	009	7 - center of Southeast area wall - level 13	11:02	13:57	175	8	8	8	1400	2.5	100	0.002	<LOD	N/A
Area	010	7 - Center stairwell area - level 13	11:03	13:58	175	8	8	8	1400	2	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	10/25/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS

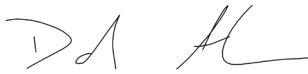
Project Name	776 Summer Street (#7 Amendment Level 13 East)(Power Plant)	Sample Date	10/26/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	7 - northeast wall - level 13	07:30	10:13	163	8	8	8	1304	3.5	100	0.002	<LOD	N/A
Area	004	7 - southeast corner area - level 13	07:31	10:14	163	8	8	8	1304	6	100	0.002	0.002	N/A
Area	005	7 - center of Southeast area wall - level 13	07:32	10:15	163	8	8	8	1304	4	100	0.002	0.002	N/A
Area	006	7 - Center stairwell area - level 13	07:33	10:16	163	8	8	8	1304	5.5	100	0.002	0.002	N/A
Background	007	7 - east wall adjacent to stairway - level 12	11:02	14:08	186	8	8	8	1488	3	100	0.002	<LOD	N/A
Background	008	7 - southeast area of South wall - level 12	11:03	14:09	186	8	8	8	1488	3.5	100	0.002	<LOD	N/A
Background	009	7 - southwest area of South wall - level 12	11:04	14:10	186	8	8	8	1488	5	100	0.002	0.002	N/A
Background	010	7 - west wall level 12	11:05	14:11	186	8	8	8	1488	2.5	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	10/26/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (#7 Amendment Level 12 West)(Power Plant)	Sample Date	10/27/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Background	003	7 - east wall adjacent to stairway - level 12	07:46	10:42	176	8	8	8	1408	3	100	0.002	<LOD	N/A
Background	004	7 - southeast area of South wall - level 12	07:47	10:43	176	8	8	8	1408	2.5	100	0.002	<LOD	N/A
Background	005	7 - southwest area of South wall - level 12	07:48	10:44	176	8	8	8	1408	5	100	0.002	0.002	N/A
Background	006	7 - west wall level 12	07:49	10:45	176	8	8	8	1408	5.5	100	0.002	0.002	N/A
Area	007	7 - east wall adjacent to stairway - level 12	10:42	13:46	184	8	8	8	1472	2.5	100	0.002	<LOD	N/A
Area	008	7 - southeast area of South wall - level 12	10:43	13:47	184	8	8	8	1472	2.5	100	0.002	<LOD	N/A
Area	009	7 - southwest area of South wall - level 12	10:44	13:48	184	8	8	8	1472	6.5	100	0.002	0.002	N/A
Area	010	7 - west wall level 12	10:45	13:49	184	8	8	8	1472	5	100	0.002	0.002	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	10/27/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS


Project Name	776 Summer Street (#3 Amendment Area 2)(Power Plant)	Sample Date	10/30/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Summer Street	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	3 - northwest area of containment on sidewalk	07:25	10:35	190	8	8	8	1520	2	100	0.002	<LOD	N/A
Area	004	3 - southwest area of containment on sidewalk	07:26	10:36	190	8	8	8	1520	2	100	0.002	<LOD	N/A
Area	005	3 - southeast area of containment at decon	07:27	10:37	190	8	8	8	1520	1	100	0.002	<LOD	N/A
Area	006	3 - northeast area of containment at hepa exhaust	07:28	10:38	190	8	8	8	1520	1.5	100	0.002	<LOD	N/A
Area	007	3 - northwest area of containment on sidewalk	10:35	13:40	185	8	8	8	1480	2.5	100	0.002	<LOD	N/A
Area	008	3 - southwest area of containment on sidewalk	10:36	13:41	185	8	8	8	1480	1.5	100	0.002	<LOD	N/A
Area	009	3 - southeast area of containment at decon	10:37	13:42	185	8	8	8	1480	1	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	010	3 - northeast area of containment at hepa exhaust	10:38	13:43	185	8	8	8	1480	2.5	100	0.002	<LOD	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information


Analyst	David Adams	Analysis Date	10/30/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS

Project Name	776 Summer Street (#3 Amendment Area 2)(Power Plant)	Sample Date	10/31/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Summer Street	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	North area inside containment adjacent to HEPA	07:25	09:10	105	12	12	12	1260	2.5	100	0.002	<LOD	N/A
Area	004	South area inside containment at decon	07:26	09:11	105	12	12	12	1260	1.5	100	0.002	<LOD	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	10/31/2023
Analyst Signature			


ASBESTOS AIR SAMPLE RESULTS

Project Name		776 Summer Street (#7 Amendment Level 12 West)(Power Plant)					Sample Date		10/30/2023					
TRC Project #		474824					Sampling Technician		David Adams					
Client		HRP 776 Summer Street PropCo LLC					Laboratory		TRC					
Facility Name		Building 4					Sample/Analysis Method		NIOSH 7400					
Facility Location		776 summer Street, Boston, Massachusetts					Sampling Type		PCM					
Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	7 - east wall adjacent to stairway - level 12	07:37	10:45	188	8	8	8	1504	1	100	0.002	<LOD	N/A
Area	004	7 - southeast area of South wall - level 12	07:38	10:46	188	8	8	8	1504	0.5	100	0.002	<LOD	N/A
Area	005	7 - southwest area of South wall - level 12	07:39	10:47	188	8	8	8	1504	1	100	0.002	<LOD	N/A
Area	006	7 - west wall level 12	07:40	10:48	188	8	8	8	1504	1.5	100	0.002	<LOD	N/A
Area	007	7 - east wall adjacent to stairway - level 12	10:45	13:51	186	8	8	8	1488	1.5	100	0.002	<LOD	N/A
Area	008	7 - southeast area of South wall - level 12	10:46	13:52	186	8	8	8	1488	1	100	0.002	<LOD	N/A
Area	009	7 - southwest area of South wall - level 12	10:47	13:53	186	8	8	8	1488	3	100	0.002	<LOD	N/A
Area	010	7 - west wall level 12	10:48	13:54	186	8	8	8	1488	2	100	0.002	<LOD	N/A

ASBESTOS AIR SAMPLE RESULTS

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information


Analyst	David Adams	Analysis Date	10/30/2023
Analyst Signature			

ASBESTOS AIR SAMPLE RESULTS

Project Name	776 Summer Street (#7 Amendment Level 12 West)(Power Plant)	Sample Date	10/31/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	7 - east wall adjacent to stairway - level 12	07:38	10:35	177	8	8	8	1416	5	100	0.002	0.002	N/A
Area	004	7 - southeast area of South wall - level 12	07:39	10:36	177	8	8	8	1416	4.5	100	0.002	0.002	N/A
Area	005	7 - southwest area of South wall - level 12	07:40	10:37	177	8	8	8	1416	3	100	0.002	<LOD	N/A
Area	006	7 - west wall level 12	07:41	10:38	177	8	8	8	1416	2.5	100	0.002	<LOD	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information


Analyst	David Adams		
Analyst Signature		Analysis Date	10/31/2023

ASBESTOS AIR SAMPLE RESULTS

Project Name	776 Summer Street (#7 Amendment - Level 12 East)(Power Plant)	Sample Date	10/31/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 4	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	7 - east wall - level 12	11:00	13:56	176	8	8	8	1408	5.5	100	0.002	0.002	N/A
Area	004	7 - southeast corner of South wall - level 12	11:01	13:57	176	8	8	8	1408	4	100	0.002	<LOD	N/A
Area	005	7 - center of Southeast area wall - level 12	11:02	13:58	176	8	8	8	1408	2	100	0.002	<LOD	N/A
Area	006	7 - southwest area of South wall at center stairwell - level 12	11:03	13:59	176	8	8	8	1408	2	100	0.002	<LOD	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	10/31/2023
Analyst Signature			

Project Name	776 Summer Street (#3 Amendment Area 3)(Power Plant)	Sample Date	10/31/2023
TRC Project #	474824	Sampling Technician	David Adams
Client	HRP 776 Summer Street PropCo LLC	Laboratory	TRC
Facility Name	Building 3 Footprint	Sample/Analysis Method	NIOSH 7400
Facility Location	776 Summer Street, Boston, Massachusetts	Sampling Type	PCM

Sample Type	Sample #	Sample Location	Time On	Time Off	Total Time	Pre (L/m)	Post (L/m)	Avg (L/m)	Total Volume (L)	Total Fibers	Total Fields	LOD (f/cc)	Results (f/cc)	Notes
Area	003	3 - northwest area of containment on sidewalk	12:04	14:09	125	10	10	10	1250	6	100	0.002	0.002	N/A
Area	004	3 - southwest area of containment on sidewalk	12:05	14:10	125	10	10	10	1250	4.5	100	0.002	0.002	N/A
Area	005	3 - southeast area of containment at decon	12:06	14:11	125	10	10	10	1250	3	100	0.002	<LOD	N/A
Area	006	3 - northeast area of containment at hepa exhaust	12:07	14:12	125	8	8	8	1000	5.5	100	0.003	0.003	N/A
Field Blank	001	Field Blank 1	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A
Field Blank	002	Field Blank 2	N/A	N/A	N/A	N/A	N/A	N/A	N/A	0	100	N/A	N/A	N/A

Analysis Information

Analyst	David Adams	Analysis Date	10/31/2023
Analyst Signature	