

MONTHLY DUST MONITORING REPORT
L Street Station Project
Boston, Massachusetts

Prepared for: HRP 776 Summer Street, LLC
File No. 4867.03
March 2022

MONTHLY DUST MONITORING REPORT

L STREET STATION PROJECT

MARCH 2022

1.0 INTRODUCTION

Sanborn, Head & Associates, Inc. (Sanborn Head) has prepared this Monthly Dust Monitoring Report on behalf of HRP 776 Summer Street, LLC (the Client) for the deconstruction phase of the L Street Station project at 776 Summer Street in Boston, Massachusetts (the Site). A Locus Plan showing the location of the Site is provided as Figure 1.

A site perimeter Dust Monitoring Plan (DMP) was prepared for the project to establish project action levels, a real-time monitoring program, and mitigation protocols. During the implementation of the DMP, measures were taken by the deconstruction subcontractor, NorthStar Contracting Group, Inc. (NorthStar), working under the project construction manager, Suffolk Construction Company (Suffolk), to provide effective and timely dust control measures to minimize fugitive dust emissions at the Site. This report provides the dust monitoring results collected at the Site in March 2022.

2.0 DESCRIPTION OF SITE CONDITIONS

The Site, as shown on Figure 2, consists of one parcel comprising approximately 15 acres. For at least a century, the Site previously operated as the New Boston Generating Station, an electrical power plant. With the exception of one building, referred to as the Administration Office Building, the Site is vacant and abandoned and contains seven main structures with eight ancillary structures that were used when the Site operated as a power plant. The main facility consists of both single and multi-story structures that are in the process of being deconstructed.

The Site features consist of exhaust stacks, turbine rooms, boiler rooms, switch houses, screen houses, sheds, and electrical transformers. The eastern portion of the Site that was previously used for coal storage, wastewater operations, and contained wastewater impoundments was heavily vegetated prior to the start of deconstruction. There is a paved area to the north of the vegetated area. A water body that is part of the Reserved Channel is located in the northwestern portion of the Site.

The Site is located in a highly urbanized area of South Boston with flat topography. It is bounded to the west by Summer Street, to the south by East First Street, and to the north by the Dedicated Freight Corridor (Massport) roadway.

3.0 DUST ACTION LEVELS

To calculate a site-specific, risk-based dust level for the Site, risk calculations were performed by Sanborn Head assuming a child would be present immediately adjacent to the Site during earthwork. The child receptor was assumed to be present 8 hours per day, 5 days per week, for 2 years, and the dust concentration was assumed to be equal to the Massachusetts Ambient Air Quality Standard and USEPA National Ambient Air Quality

Standard (NAAQS) of 150 $\mu\text{g}/\text{m}^3$. Sanborn Head used the maximum concentrations detected in soil samples collected recently at the Site to model dust concentrations. The dust calculations are provided in Appendix A. Non-cancer and cancer risk estimates for the child receptor based on these conservative exposure assumptions are well below Massachusetts Contingency Plan (MCP) non-cancer and cancer risk limits.

Based on the results, a dust level of 150 $\mu\text{g}/\text{m}^3$ for PM10 particulates based on a 24-hr average was chosen as the project dust action level.

4.0 PERIMETER DUST MONITORING

Real-time perimeter dust monitoring is being performed during deconstruction activities. Six laser-photometer-based aerosol monitors (i.e., TSI Dust Trak II Aerosol Monitor, or equivalent) provide full-time dust monitoring around the Site perimeter. The real-time dust monitors are equipped with telemetry and data logging capabilities. The dust monitors are stored in weatherproof stations on tripods and are equipped with solar panels and batteries.

The six dust monitors are deployed around the perimeter of the Site in the approximate locations shown on Figure 2. Two monitors are located along Summer Street (Stations 5 and 6), two are located along East First Street (Stations 3 and 4), one monitor is located along the northern side of the Site (Station 1), and one monitor is located along the eastern side of the Site (Station 2). The locations of the monitoring stations may be adjusted if needed as the work progresses. The dust monitors were deployed prior to the start of work to collect baseline data for the Site.

Dust data was collected in accordance with the site perimeter DMP, and the results for March 2022 are included on Figure 3. As shown on the figure, there were no exceedances of the dust action level of 150 $\mu\text{g}/\text{m}^3$ for PM10 particulates based on a 24-hr average.

5.0 CORRECTIVE MEASURES

No corrective measures were required for dust mitigation in March 2022 because dust concentrations collected were well below the calculated Site-specific action level.



6.0 EQUIPMENT MAINTENANCE

Due to varying sunlight hours and weather conditions, the dust monitor at stations 2 and 5 had variable functionality during this reporting period. New equipment was ordered and an additional fully charged battery remains on site to allow for more continuous operation. The other monitors remained operational during the time period covered by this report.

FIGURES

- Figure 1 Locus Plan
- Figure 2 Dust Monitoring Location Plan
- Figure 3 March 2022 Dust Concentration 24-hour Averages

FIGURES

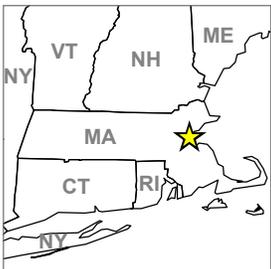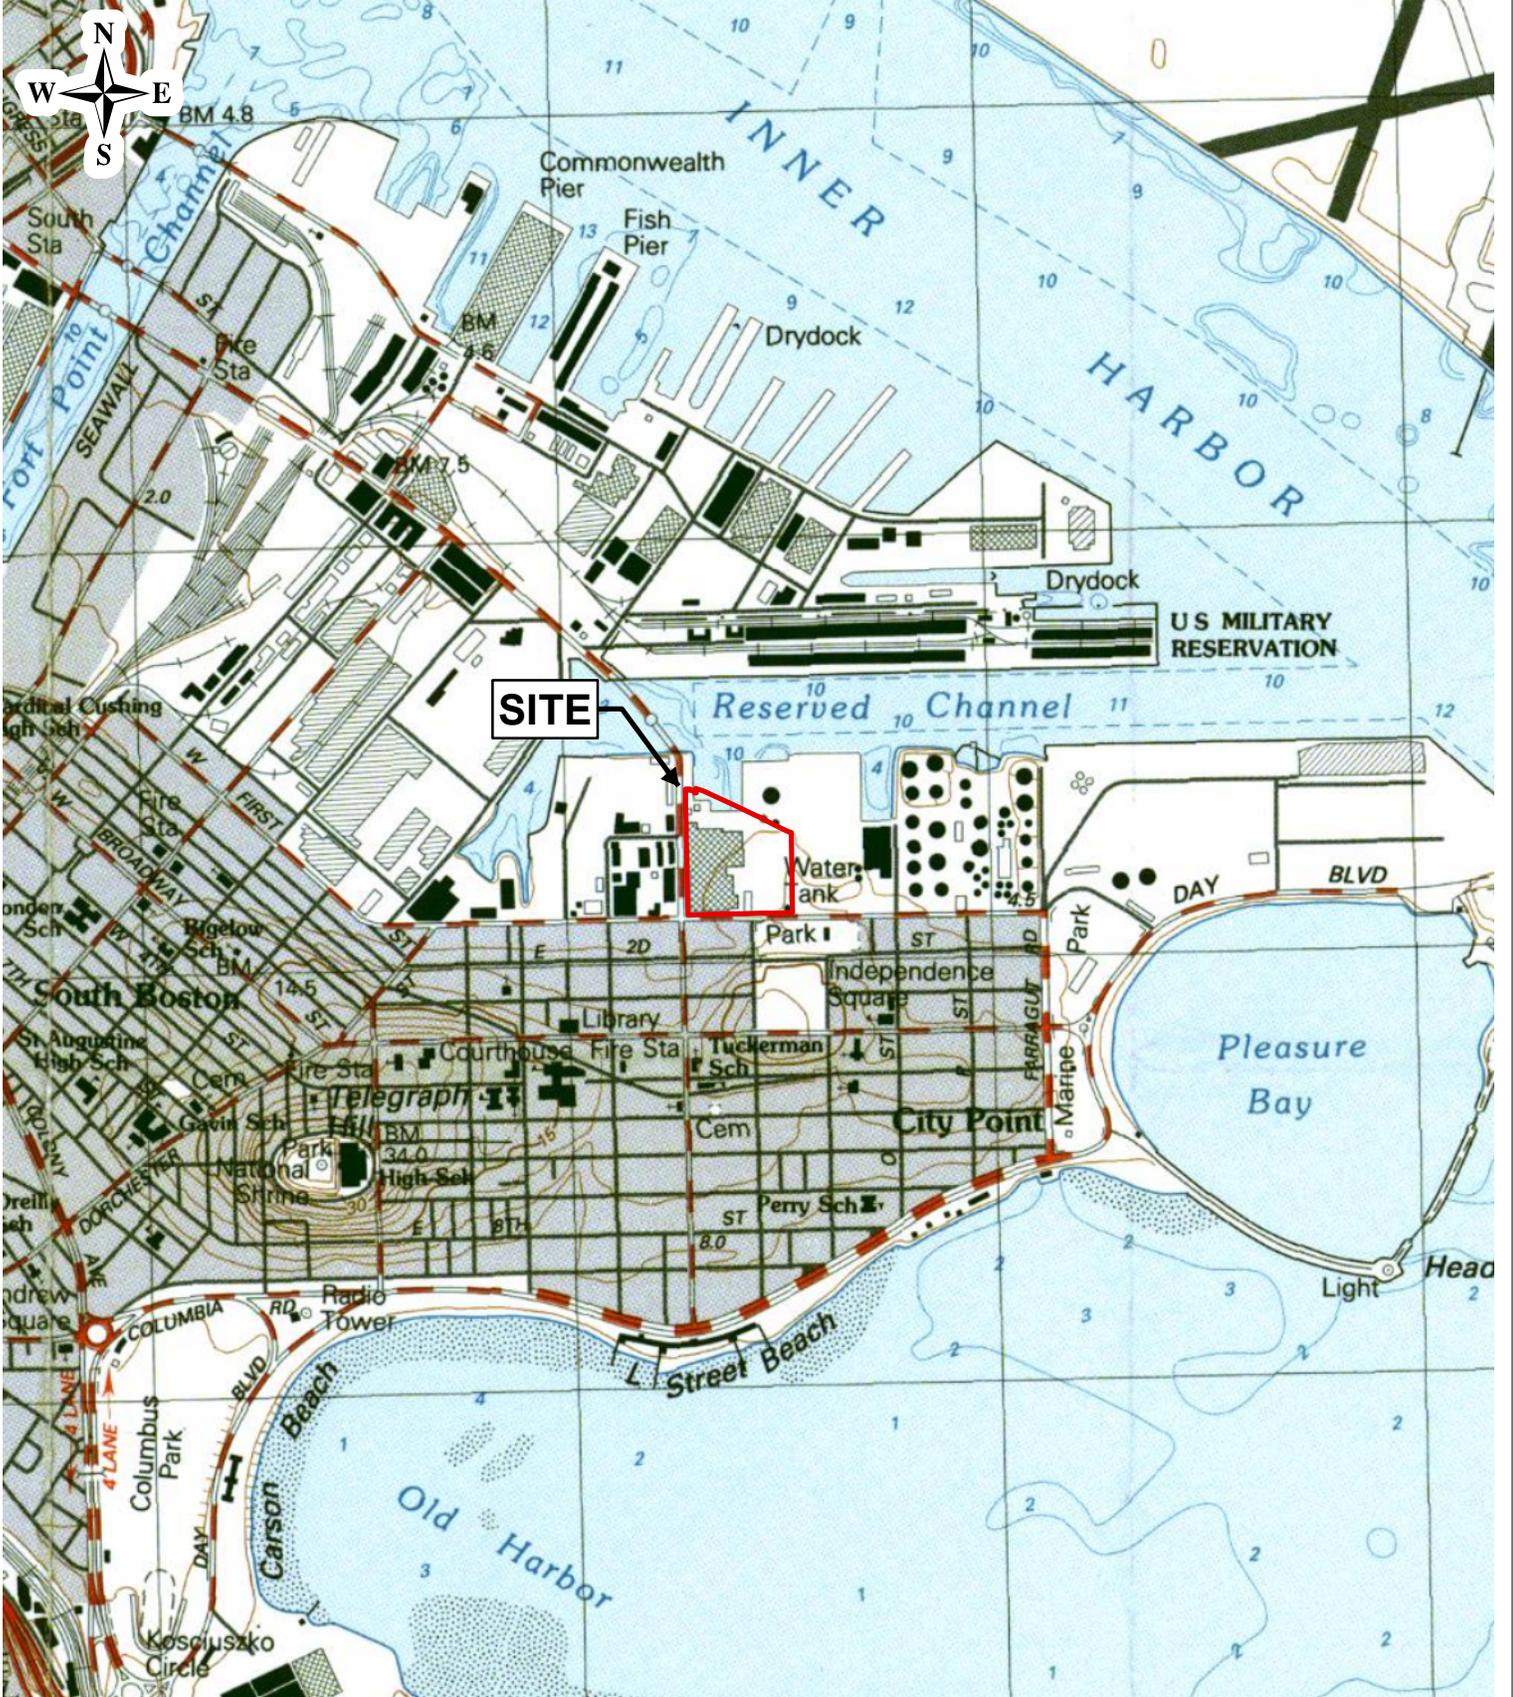

Drawn By: Z. Svoboda
 Designed By: T. Snay
 Reviewed By: P. Pinto
 Project No: 4867.03
 Date: March 2022




SANBORN HEAD

Figure 1

Locus Plan

Dust Monitoring Report


776 Summer Street
Boston, Massachusetts

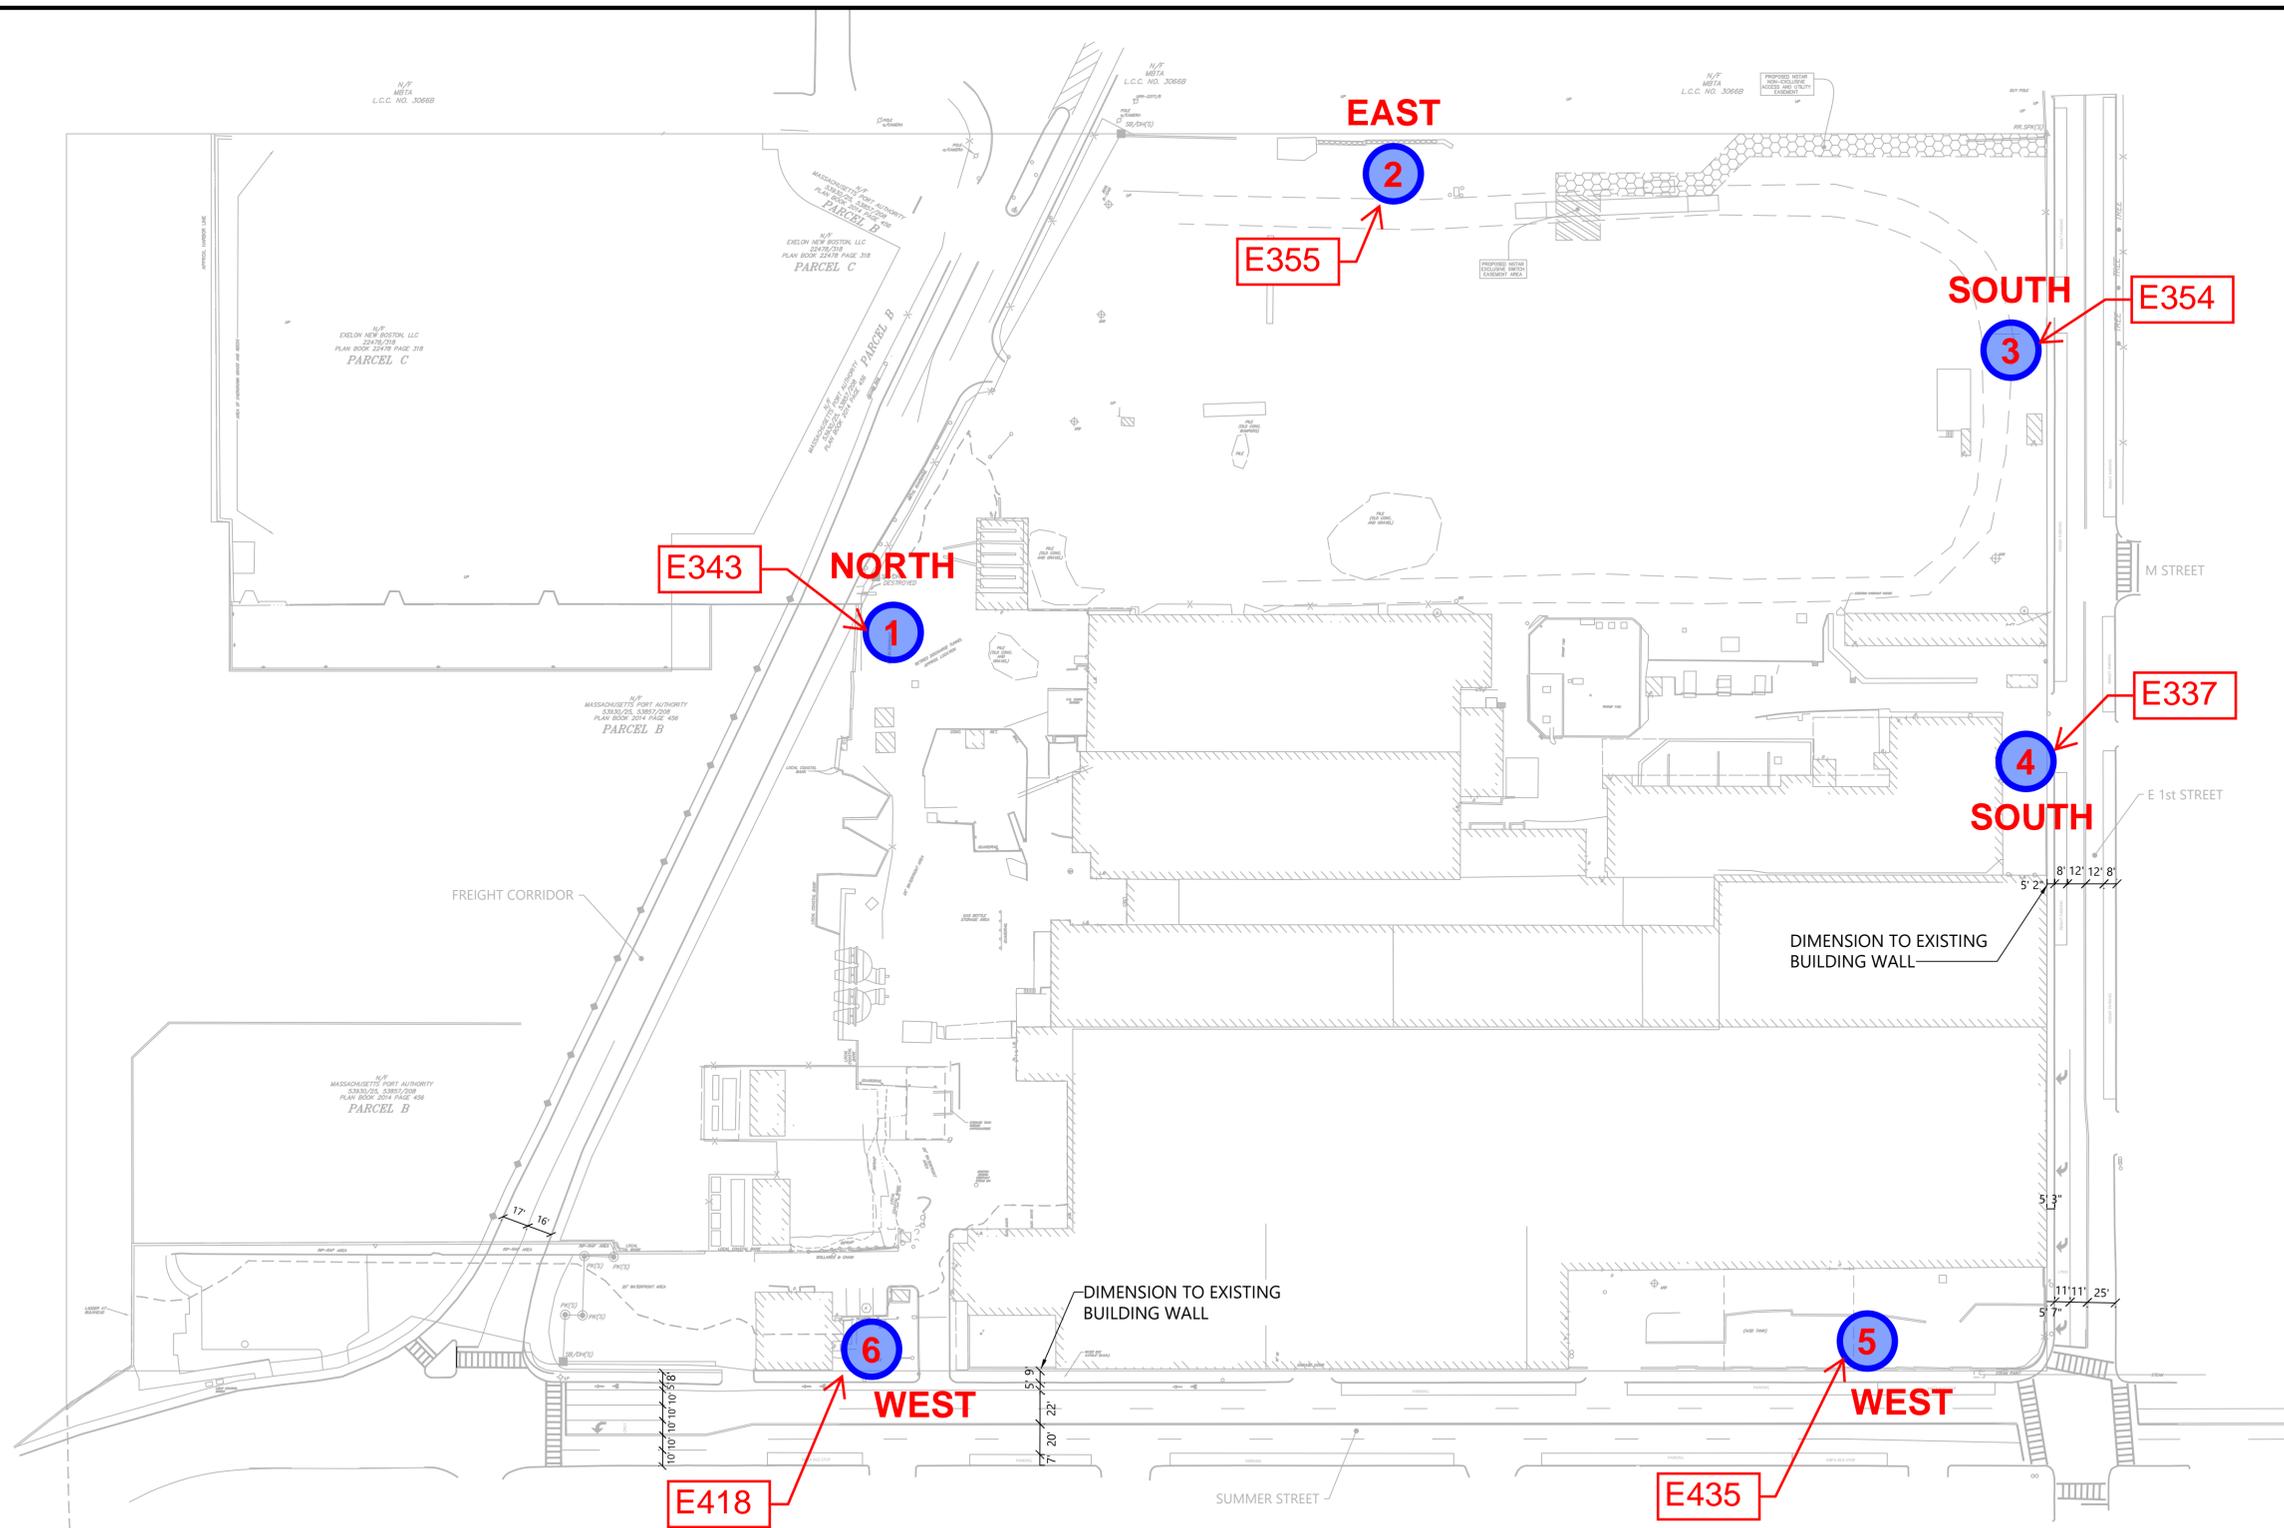

776 Summer Street - Deconstruction
 SOUTH BOSTON
 EXISTING CONDITIONS
FIGURE 2
DUST MONITORING LOCATION PLAN

March 2022 Dust Concentration 24-hour Averages

776 Summer Street
Boston, Massachusetts

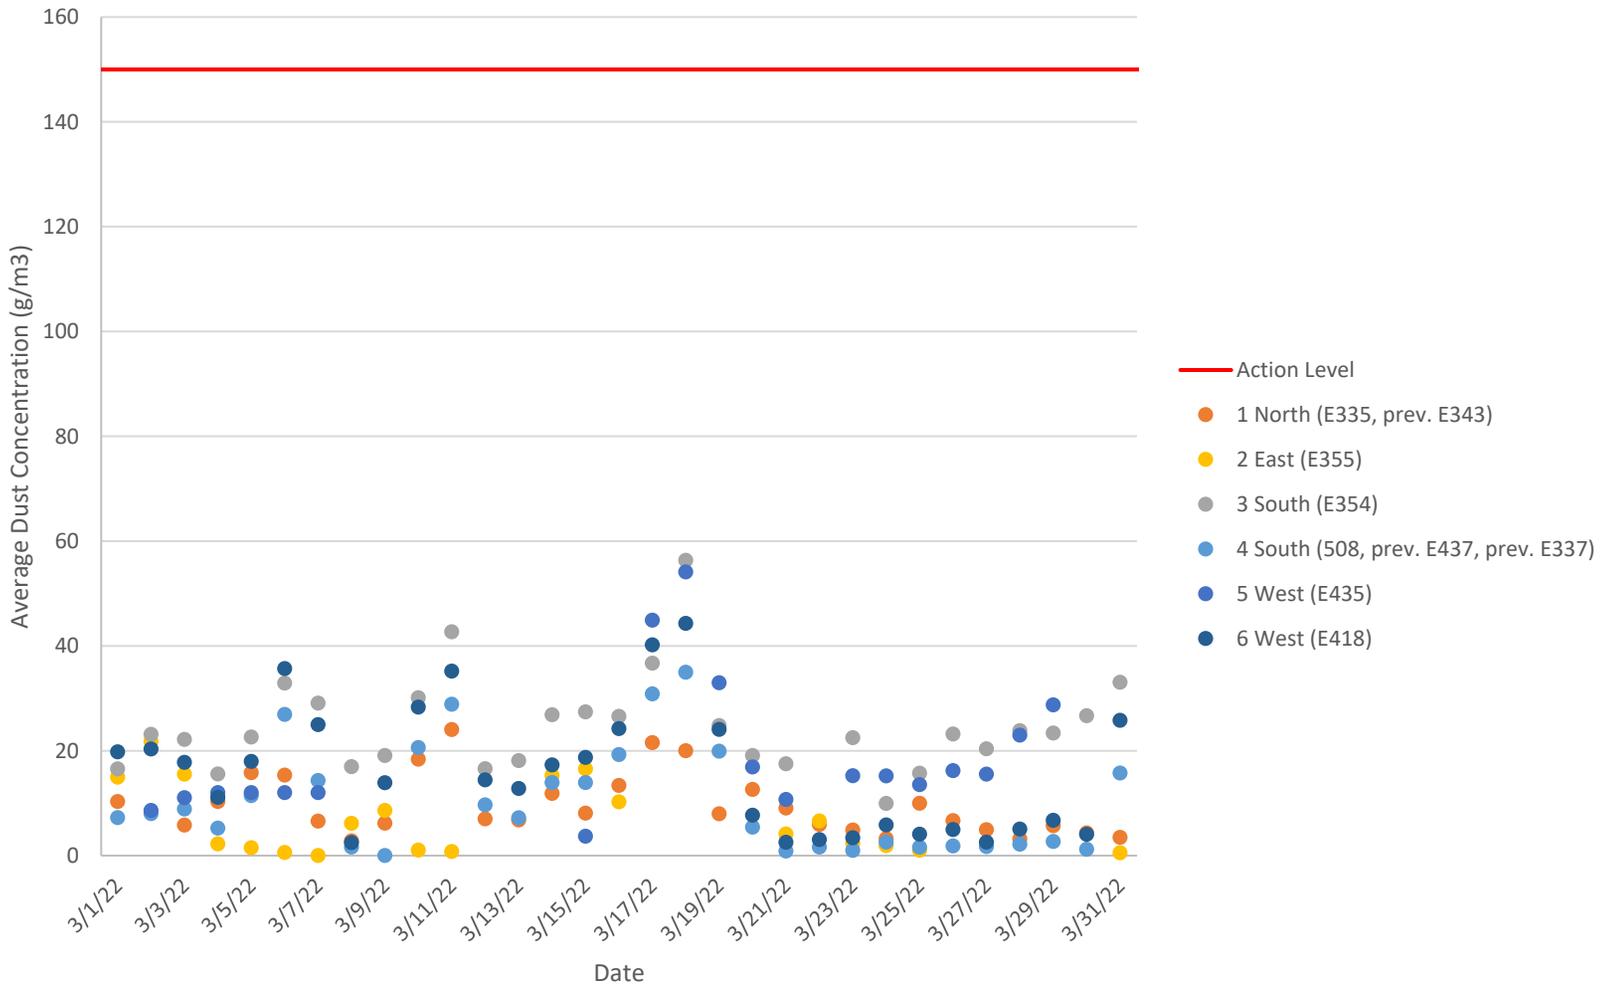



www.sanbornhead.com